

EN

DECLARATION OF PERFORMANCE

according to Annex III of the Regulation (EU) Nr. 305/2011 (Construction Products Regulation)

Hilti self-drilling fastening screws S-MD Z, S-MD C
No. Hilti-SF-DoP-001

1. Unique identification code of the product-type: Hilti self-drilling fastening screws S-MD Z, S-MD C

2. Type, batch or serial number or any other element allowing identification of the construction product as required pursuant to Article 11(4): Type and Lot-Number displayed on the packaging

3. Intended use or uses of the construction product, in accordance with the applicable harmonized technical specification, as foreseen by the manufacturer:

Generic type and use	Self-drilling fastening screws for metal members and sheeting
Product size covered	Screw diameter 4.2 mm, 4.8 mm, 5.5 mm and 6.3 mm
Base and fastened material	Steel according to EN 10025-1 and EN 10346
Fastener material	Galvanized or coated, case-hardened carbon steel according to EN 10084
Loading	Static & quasi static (wind loading)

4. Name, registered trade name or registered trade mark and contact address of the manufacturer as required pursuant to Article 11(5): Hilti Aktiengesellschaft, Business Unit Direct Fastening, 9494 Schaan, Fürstentum Liechtenstein

5. Where applicable, name and contact address of the authorised representative whose mandate covers the tasks specified in Article 12(2): n.a.

6. System or systems of assessment and verification of constancy of performance of the construction product as set out in Annex V: System 2+

7. In case of the declaration of performance concerning a construction product covered by a harmonized standard: n.a.

8. In case of the declaration of performance concerning a construction product for which a European Technical Assessment has been issued:

On the basis of EAD 330046-01-0602 issued ETA-10/0182. The notified body MPA-Karlsruhe 0769 performed third party tasks under system 2+ and issued the certificate of conformity of the production control.

9. Declared performance:

Essential characteristic	Performance	Harmonized technical specification
Characteristic tension resistance $N_{R,k}$	Annex 1 - 20 ETA-10/0182 (Annex 10 – 29)	ETA-10/0182 EAD 330046-01-0602
Characteristic shear resistance $V_{R,k}$		
Types of connection		
Application limits		
Reaction to fire	A1	

10. The performance of the product identified in points 1 and 2 is in conformity with the declared performance in point 9. This declaration of performance is issued under the sole responsibility of the manufacturer identified in point 4.

Signed for and on behalf of the manufacturer by:

Lars Taenzer
Head of Business Unit Direct Fastening

Pierre Hohmeier
Head of Quality Screw Fastening

Hilti Aktiengesellschaft, Schaan, 03.05.2019

Annex 1:
ETA-10/0182, Annex 10

Material:
Fastener: carbon steel, case hardened and galvanized or coated
Washer: none
Component I: S280GD, S320GD - EN 10346
Component II: S280GD, S320GD - EN 10346
S235 - EN 10025-1

Drilling capacity: $\Sigma t_i \leq 2,50$ mm

Timber substructures:
no performance determined

t [mm]	t _i [mm]									
	0,63	0,75	0,88	1,00	1,13	1,25	1,50	2,00		
V _{ex} [kN]	0,50	—	—	—	—	—	—	—	—	—
	0,55	—	—	—	—	—	—	—	—	—
	0,63	1,50	2,00	2,50	2,80	2,80	ac	2,80	ac	2,80
	0,75	1,70	2,10	2,80	3,00	3,80	—	4,00	—	4,00
	0,88	1,80	2,20	2,80	3,30	4,00	—	4,50	—	4,50
	1,00	1,90	2,40	3,00	3,80	4,30	—	5,00	—	5,00
	1,13	1,90	2,40	3,00	3,80	4,30	—	5,00	—	—
	1,25	1,90	2,40	3,00	3,80	4,30	—	5,00	—	—
	1,50	1,90	2,40	3,00	3,80	—	—	—	—	—
	1,75	1,90	2,40	—	—	—	—	—	—	—
2,00	—	—	—	—	—	—	—	—	—	
N _{ex} [kN]	0,50	—	—	—	—	—	—	—	—	—
	0,55	—	—	—	—	—	—	—	—	—
	0,63	0,90	1,20	1,40	1,40	1,40	ac	1,40	ac	1,40
	0,75	0,90	1,20	1,40	1,70	1,90	—	2,00	—	2,00
	0,88	0,90	1,20	1,40	1,70	1,90	—	2,20	—	2,70
	1,00	0,90	1,20	1,40	1,70	1,90	—	2,20	—	2,80
	1,13	0,90	1,20	1,40	1,70	1,90	—	2,20	—	—
	1,25	0,90	1,20	1,40	1,70	1,90	—	2,20	—	—
	1,50	0,90	1,20	1,40	1,70	—	—	—	—	—
	1,75	0,90	1,20	—	—	—	—	—	—	—
2,00	—	—	—	—	—	—	—	—	—	
M _{torq} [Nm]	$\Sigma t_i \leq 1,25$ mm: 2 Nm					$\Sigma t_i > 1,25$ mm: 4 Nm				


No additional regulations.

Self drilling screw

Hilti S-MD 01 Z 4,2 x L
Hilti S-MD 01 C 4,2 x L
with hexagon head

Annex 10

Annex 2:
ETA-10/0182, Annex 11

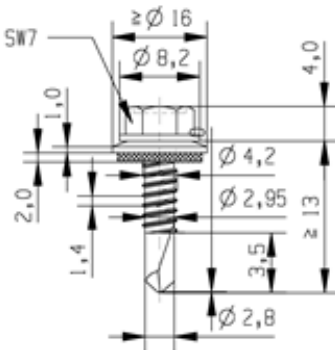	<p>Material:</p> <p>Fastener: carbon steel, case hardened and galvanized or coated</p> <p>Washer: carbon steel, galvanized or coated stainless Steel (1.4301) - EN 10088</p> <p>Component I: S280GD, S320GD - EN 10346</p> <p>Component II: S280GD, S320GD - EN 10346 S235 - EN 10025-1</p>																																																																																																																																																																																																																																			
	<p>Drilling capacity: $\Sigma t \leq 2,50$ mm</p>																																																																																																																																																																																																																																			
<p>Timber substructures: no performance determined</p>																																																																																																																																																																																																																																				
<table border="1"> <thead> <tr> <th>t [mm]</th> <th colspan="8">t_1 [mm]</th> </tr> <tr> <th></th> <th>0,63</th> <th>0,75</th> <th>0,88</th> <th>1,00</th> <th>1,13</th> <th>1,25</th> <th>1,50</th> <th>2,00</th> </tr> </thead> <tbody> <tr> <td rowspan="11">$V_{k,s}$ [kN]</td> <td>0,50</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td>0,55</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td>0,63</td><td>1,40</td><td>—</td><td>1,80</td><td>—</td><td>2,40</td><td>—</td><td>3,00</td><td>—</td> </tr> <tr> <td>0,75</td><td>1,40</td><td>—</td><td>1,80</td><td>—</td><td>2,40</td><td>—</td><td>3,00</td><td>—</td> </tr> <tr> <td>0,88</td><td>1,40</td><td>—</td><td>1,80</td><td>—</td><td>2,40</td><td>—</td><td>3,00</td><td>—</td> </tr> <tr> <td>1,00</td><td>1,40</td><td>—</td><td>1,80</td><td>—</td><td>2,40</td><td>—</td><td>3,00</td><td>—</td> </tr> <tr> <td>1,13</td><td>1,40</td><td>—</td><td>1,80</td><td>—</td><td>2,40</td><td>—</td><td>3,00</td><td>—</td> </tr> <tr> <td>1,25</td><td>1,40</td><td>—</td><td>1,80</td><td>—</td><td>2,40</td><td>—</td><td>3,00</td><td>—</td> </tr> <tr> <td>1,50</td><td>1,40</td><td>—</td><td>1,80</td><td>—</td><td>2,40</td><td>—</td><td>3,00</td><td>—</td> </tr> <tr> <td>1,75</td><td>1,40</td><td>—</td><td>1,80</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td>2,00</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td rowspan="11">$N_{k,s}$ [kN]</td> <td>0,50</td><td>0,49</td><td>—</td><td>0,65</td><td>—</td><td>0,76</td><td>—</td><td>0,92</td><td>—</td> </tr> <tr> <td>0,55</td><td>0,61</td><td>—</td><td>0,82</td><td>—</td><td>0,95</td><td>—</td><td>1,16</td><td>—</td> </tr> <tr> <td>0,63</td><td>0,90</td><td>—</td><td>1,20</td><td>—</td><td>1,40</td><td>—</td><td>1,70</td><td>—</td> </tr> <tr> <td>0,75</td><td>0,90</td><td>—</td><td>1,20</td><td>—</td><td>1,40</td><td>—</td><td>1,70</td><td>—</td> </tr> <tr> <td>0,88</td><td>0,90</td><td>—</td><td>1,20</td><td>—</td><td>1,40</td><td>—</td><td>1,70</td><td>—</td> </tr> <tr> <td>1,00</td><td>0,90</td><td>—</td><td>1,20</td><td>—</td><td>1,40</td><td>—</td><td>1,70</td><td>—</td> </tr> <tr> <td>1,13</td><td>0,90</td><td>—</td><td>1,20</td><td>—</td><td>1,40</td><td>—</td><td>1,70</td><td>—</td> </tr> <tr> <td>1,25</td><td>0,90</td><td>—</td><td>1,20</td><td>—</td><td>1,40</td><td>—</td><td>1,70</td><td>—</td> </tr> <tr> <td>1,50</td><td>0,90</td><td>—</td><td>1,20</td><td>—</td><td>1,40</td><td>—</td><td>1,70</td><td>—</td> </tr> <tr> <td>1,75</td><td>0,90</td><td>—</td><td>1,20</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td>2,00</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td>$M_{t,adm}$ [Nm]</td> <td colspan="4">$\Sigma t \leq 1,25$ mm: 2 Nm</td> <td colspan="4">$\Sigma t > 1,25$ mm: 4 Nm</td> </tr> </tbody> </table>		t [mm]	t_1 [mm]									0,63	0,75	0,88	1,00	1,13	1,25	1,50	2,00	$V_{k,s}$ [kN]	0,50	—	—	—	—	—	—	—	—	0,55	—	—	—	—	—	—	—	—	0,63	1,40	—	1,80	—	2,40	—	3,00	—	0,75	1,40	—	1,80	—	2,40	—	3,00	—	0,88	1,40	—	1,80	—	2,40	—	3,00	—	1,00	1,40	—	1,80	—	2,40	—	3,00	—	1,13	1,40	—	1,80	—	2,40	—	3,00	—	1,25	1,40	—	1,80	—	2,40	—	3,00	—	1,50	1,40	—	1,80	—	2,40	—	3,00	—	1,75	1,40	—	1,80	—	—	—	—	—	2,00	—	—	—	—	—	—	—	—	$N_{k,s}$ [kN]	0,50	0,49	—	0,65	—	0,76	—	0,92	—	0,55	0,61	—	0,82	—	0,95	—	1,16	—	0,63	0,90	—	1,20	—	1,40	—	1,70	—	0,75	0,90	—	1,20	—	1,40	—	1,70	—	0,88	0,90	—	1,20	—	1,40	—	1,70	—	1,00	0,90	—	1,20	—	1,40	—	1,70	—	1,13	0,90	—	1,20	—	1,40	—	1,70	—	1,25	0,90	—	1,20	—	1,40	—	1,70	—	1,50	0,90	—	1,20	—	1,40	—	1,70	—	1,75	0,90	—	1,20	—	—	—	—	—	2,00	—	—	—	—	—	—	—	—	$M_{t,adm}$ [Nm]	$\Sigma t \leq 1,25$ mm: 2 Nm				$\Sigma t > 1,25$ mm: 4 Nm			
t [mm]	t_1 [mm]																																																																																																																																																																																																																																			
	0,63	0,75	0,88	1,00	1,13	1,25	1,50	2,00																																																																																																																																																																																																																												
$V_{k,s}$ [kN]	0,50	—	—	—	—	—	—	—	—																																																																																																																																																																																																																											
	0,55	—	—	—	—	—	—	—	—																																																																																																																																																																																																																											
	0,63	1,40	—	1,80	—	2,40	—	3,00	—																																																																																																																																																																																																																											
	0,75	1,40	—	1,80	—	2,40	—	3,00	—																																																																																																																																																																																																																											
	0,88	1,40	—	1,80	—	2,40	—	3,00	—																																																																																																																																																																																																																											
	1,00	1,40	—	1,80	—	2,40	—	3,00	—																																																																																																																																																																																																																											
	1,13	1,40	—	1,80	—	2,40	—	3,00	—																																																																																																																																																																																																																											
	1,25	1,40	—	1,80	—	2,40	—	3,00	—																																																																																																																																																																																																																											
	1,50	1,40	—	1,80	—	2,40	—	3,00	—																																																																																																																																																																																																																											
	1,75	1,40	—	1,80	—	—	—	—	—																																																																																																																																																																																																																											
	2,00	—	—	—	—	—	—	—	—																																																																																																																																																																																																																											
$N_{k,s}$ [kN]	0,50	0,49	—	0,65	—	0,76	—	0,92	—																																																																																																																																																																																																																											
	0,55	0,61	—	0,82	—	0,95	—	1,16	—																																																																																																																																																																																																																											
	0,63	0,90	—	1,20	—	1,40	—	1,70	—																																																																																																																																																																																																																											
	0,75	0,90	—	1,20	—	1,40	—	1,70	—																																																																																																																																																																																																																											
	0,88	0,90	—	1,20	—	1,40	—	1,70	—																																																																																																																																																																																																																											
	1,00	0,90	—	1,20	—	1,40	—	1,70	—																																																																																																																																																																																																																											
	1,13	0,90	—	1,20	—	1,40	—	1,70	—																																																																																																																																																																																																																											
	1,25	0,90	—	1,20	—	1,40	—	1,70	—																																																																																																																																																																																																																											
	1,50	0,90	—	1,20	—	1,40	—	1,70	—																																																																																																																																																																																																																											
	1,75	0,90	—	1,20	—	—	—	—	—																																																																																																																																																																																																																											
	2,00	—	—	—	—	—	—	—	—																																																																																																																																																																																																																											
$M_{t,adm}$ [Nm]	$\Sigma t \leq 1,25$ mm: 2 Nm				$\Sigma t > 1,25$ mm: 4 Nm																																																																																																																																																																																																																															
<p>No additional regulations.</p>																																																																																																																																																																																																																																				
<p>Self drilling screw</p>																																																																																																																																																																																																																																				
<p>Hilti S-MD 51 Z 4,2 x L Hilti S-MD 51 C 4,2 x L with hexagon head and sealing washer $\geq \phi 16$ mm</p>																																																																																																																																																																																																																																				
<p>Annex 11</p>																																																																																																																																																																																																																																				

Annex 3:
ETA-10/0182, Annex 12

	<p>Material:</p> <p>Fastener: carbon steel, case hardened and galvanized or coated</p> <p>Washer: none</p> <p>Component I: S280GD, S320GD - EN 10346</p> <p>Component II: S280GD, S320GD - EN 10346 S235 - EN 10025-1</p>																																																																																																																																																																																																																																				
	<p>Drilling capacity: $\Sigma t_i \leq 2,75$ mm</p>																																																																																																																																																																																																																																				
	<p>Timber substructures: no performance determined</p>																																																																																																																																																																																																																																				
<table border="1"> <thead> <tr> <th>t_i [mm]</th> <th colspan="8">t_i [mm]</th> </tr> <tr> <th></th> <th>0,63</th> <th>0,75</th> <th>0,88</th> <th>1,00</th> <th>1,13</th> <th>1,25</th> <th>1,50</th> <th>2,00</th> </tr> </thead> <tbody> <tr> <td rowspan="11">$V_{d,s}$ [kN]</td> <td>0,50</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td>0,55</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td>0,63</td><td>1,40</td><td>1,80</td><td>2,10</td><td>2,40</td><td>2,70</td><td>3,00 ac</td><td>3,60 ac</td><td>3,60 ac</td> </tr> <tr> <td>0,75</td><td>1,40</td><td>1,90</td><td>2,30</td><td>2,70</td><td>3,10</td><td>3,50</td><td>4,40</td><td>4,40 a</td> </tr> <tr> <td>0,88</td><td>1,40</td><td>1,90</td><td>2,40</td><td>2,90</td><td>3,30</td><td>3,90</td><td>5,10</td><td>—</td> </tr> <tr> <td>1,00</td><td>1,40</td><td>1,90</td><td>2,40</td><td>3,00</td><td>3,60</td><td>4,30</td><td>5,80</td><td>—</td> </tr> <tr> <td>1,13</td><td>1,40</td><td>1,90</td><td>2,40</td><td>3,00</td><td>3,60</td><td>4,30</td><td>5,80</td><td>—</td> </tr> <tr> <td>1,25</td><td>1,40</td><td>1,90</td><td>2,40</td><td>3,00</td><td>3,60</td><td>4,30</td><td>5,80</td><td>—</td> </tr> <tr> <td>1,50</td><td>1,40</td><td>2,00</td><td>2,70</td><td>3,50</td><td>4,40</td><td>5,40</td><td>—</td><td>—</td> </tr> <tr> <td>1,75</td><td>1,40</td><td>2,00</td><td>2,70</td><td>3,50</td><td>—</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td>2,00</td><td>1,40</td><td>2,00</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td rowspan="11">$N_{d,s}$ [kN]</td> <td>0,50</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td>0,55</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td>0,63</td><td>0,80</td><td>1,00</td><td>1,30</td><td>1,40</td><td>1,40</td><td>1,40 ac</td><td>1,40 ac</td><td>1,40 ac</td> </tr> <tr> <td>0,75</td><td>0,80</td><td>1,00</td><td>1,30</td><td>1,50</td><td>1,80</td><td>2,00</td><td>2,00</td><td>2,00 a</td> </tr> <tr> <td>0,88</td><td>0,80</td><td>1,00</td><td>1,30</td><td>1,50</td><td>1,80</td><td>2,10</td><td>2,70</td><td>—</td> </tr> <tr> <td>1,00</td><td>0,80</td><td>1,00</td><td>1,30</td><td>1,50</td><td>1,80</td><td>2,10</td><td>2,70</td><td>—</td> </tr> <tr> <td>1,13</td><td>0,80</td><td>1,00</td><td>1,30</td><td>1,50</td><td>1,80</td><td>2,10</td><td>2,70</td><td>—</td> </tr> <tr> <td>1,25</td><td>0,80</td><td>1,00</td><td>1,30</td><td>1,50</td><td>1,80</td><td>2,10</td><td>2,70</td><td>—</td> </tr> <tr> <td>1,50</td><td>0,80</td><td>1,00</td><td>1,30</td><td>1,50</td><td>1,80</td><td>2,10</td><td>—</td><td>—</td> </tr> <tr> <td>1,75</td><td>0,80</td><td>1,00</td><td>1,30</td><td>1,50</td><td>—</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td>2,00</td><td>0,80</td><td>1,00</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td>$M_{d,perm}$ [Nm]</td> <td colspan="4">$\Sigma t_i \leq 1,25$ mm: 2 Nm</td> <td colspan="4">$\Sigma t_i > 1,25$ mm: 5 Nm</td> </tr> </tbody> </table>	t_i [mm]	t_i [mm]									0,63	0,75	0,88	1,00	1,13	1,25	1,50	2,00	$V_{d,s}$ [kN]	0,50	—	—	—	—	—	—	—	—	0,55	—	—	—	—	—	—	—	—	0,63	1,40	1,80	2,10	2,40	2,70	3,00 ac	3,60 ac	3,60 ac	0,75	1,40	1,90	2,30	2,70	3,10	3,50	4,40	4,40 a	0,88	1,40	1,90	2,40	2,90	3,30	3,90	5,10	—	1,00	1,40	1,90	2,40	3,00	3,60	4,30	5,80	—	1,13	1,40	1,90	2,40	3,00	3,60	4,30	5,80	—	1,25	1,40	1,90	2,40	3,00	3,60	4,30	5,80	—	1,50	1,40	2,00	2,70	3,50	4,40	5,40	—	—	1,75	1,40	2,00	2,70	3,50	—	—	—	—	2,00	1,40	2,00	—	—	—	—	—	—	$N_{d,s}$ [kN]	0,50	—	—	—	—	—	—	—	—	0,55	—	—	—	—	—	—	—	—	0,63	0,80	1,00	1,30	1,40	1,40	1,40 ac	1,40 ac	1,40 ac	0,75	0,80	1,00	1,30	1,50	1,80	2,00	2,00	2,00 a	0,88	0,80	1,00	1,30	1,50	1,80	2,10	2,70	—	1,00	0,80	1,00	1,30	1,50	1,80	2,10	2,70	—	1,13	0,80	1,00	1,30	1,50	1,80	2,10	2,70	—	1,25	0,80	1,00	1,30	1,50	1,80	2,10	2,70	—	1,50	0,80	1,00	1,30	1,50	1,80	2,10	—	—	1,75	0,80	1,00	1,30	1,50	—	—	—	—	2,00	0,80	1,00	—	—	—	—	—	—	$M_{d,perm}$ [Nm]	$\Sigma t_i \leq 1,25$ mm: 2 Nm				$\Sigma t_i > 1,25$ mm: 5 Nm				<p>No additional regulations.</p>	
t_i [mm]	t_i [mm]																																																																																																																																																																																																																																				
	0,63	0,75	0,88	1,00	1,13	1,25	1,50	2,00																																																																																																																																																																																																																													
$V_{d,s}$ [kN]	0,50	—	—	—	—	—	—	—	—																																																																																																																																																																																																																												
	0,55	—	—	—	—	—	—	—	—																																																																																																																																																																																																																												
	0,63	1,40	1,80	2,10	2,40	2,70	3,00 ac	3,60 ac	3,60 ac																																																																																																																																																																																																																												
	0,75	1,40	1,90	2,30	2,70	3,10	3,50	4,40	4,40 a																																																																																																																																																																																																																												
	0,88	1,40	1,90	2,40	2,90	3,30	3,90	5,10	—																																																																																																																																																																																																																												
	1,00	1,40	1,90	2,40	3,00	3,60	4,30	5,80	—																																																																																																																																																																																																																												
	1,13	1,40	1,90	2,40	3,00	3,60	4,30	5,80	—																																																																																																																																																																																																																												
	1,25	1,40	1,90	2,40	3,00	3,60	4,30	5,80	—																																																																																																																																																																																																																												
	1,50	1,40	2,00	2,70	3,50	4,40	5,40	—	—																																																																																																																																																																																																																												
	1,75	1,40	2,00	2,70	3,50	—	—	—	—																																																																																																																																																																																																																												
	2,00	1,40	2,00	—	—	—	—	—	—																																																																																																																																																																																																																												
$N_{d,s}$ [kN]	0,50	—	—	—	—	—	—	—	—																																																																																																																																																																																																																												
	0,55	—	—	—	—	—	—	—	—																																																																																																																																																																																																																												
	0,63	0,80	1,00	1,30	1,40	1,40	1,40 ac	1,40 ac	1,40 ac																																																																																																																																																																																																																												
	0,75	0,80	1,00	1,30	1,50	1,80	2,00	2,00	2,00 a																																																																																																																																																																																																																												
	0,88	0,80	1,00	1,30	1,50	1,80	2,10	2,70	—																																																																																																																																																																																																																												
	1,00	0,80	1,00	1,30	1,50	1,80	2,10	2,70	—																																																																																																																																																																																																																												
	1,13	0,80	1,00	1,30	1,50	1,80	2,10	2,70	—																																																																																																																																																																																																																												
	1,25	0,80	1,00	1,30	1,50	1,80	2,10	2,70	—																																																																																																																																																																																																																												
	1,50	0,80	1,00	1,30	1,50	1,80	2,10	—	—																																																																																																																																																																																																																												
	1,75	0,80	1,00	1,30	1,50	—	—	—	—																																																																																																																																																																																																																												
	2,00	0,80	1,00	—	—	—	—	—	—																																																																																																																																																																																																																												
$M_{d,perm}$ [Nm]	$\Sigma t_i \leq 1,25$ mm: 2 Nm				$\Sigma t_i > 1,25$ mm: 5 Nm																																																																																																																																																																																																																																
<p>Self drilling screw</p>		<p>Annex 12</p>																																																																																																																																																																																																																																			
<p>Hilti S-MD 01 Z 4,8 x L Hilti S-MD 01 C 4,8 x L with hexagon head</p>																																																																																																																																																																																																																																					

Annex 4:
ETA-10/0182, Annex 13

	<p>Material:</p> <p>Fastener: carbon steel, case hardened and galvanized or coated</p> <p>Washer: carbon steel, galvanized or coated stainless Steel (1.4301) - EN 10088</p> <p>Component I: S280GD, S320GD - EN 10346</p> <p>Component II: S280GD, S320GD - EN 10346 S235 - EN 10025-1</p>																																																																																																																																																																																																																																																																				
	<p>Drilling capacity: $\Sigma t_i \leq 2,75$ mm</p>																																																																																																																																																																																																																																																																				
<p>Timber substructures: no performance determined</p>																																																																																																																																																																																																																																																																					
<table border="1"> <thead> <tr> <th rowspan="2">t [mm]</th> <th colspan="9">t_i [mm]</th> </tr> <tr> <th>0,63</th> <th>0,75</th> <th>0,88</th> <th>1,00</th> <th>1,13</th> <th>1,25</th> <th>1,50</th> <th>2,00</th> <th></th> </tr> </thead> <tbody> <tr> <td rowspan="10">V_{0,x} [kN]</td> <td>0,50</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td>0,55</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td>0,63</td><td>1,30</td><td>—</td><td>1,80</td><td>—</td><td>2,30</td><td>—</td><td>2,90</td><td>ac</td><td>2,90</td> </tr> <tr> <td>0,75</td><td>1,30</td><td>—</td><td>1,80</td><td>—</td><td>2,30</td><td>—</td><td>2,90</td><td>ac</td><td>3,70</td> </tr> <tr> <td>0,88</td><td>1,30</td><td>—</td><td>1,80</td><td>—</td><td>2,30</td><td>—</td><td>2,90</td><td>ac</td><td>3,70</td> </tr> <tr> <td>1,00</td><td>1,30</td><td>—</td><td>1,80</td><td>—</td><td>2,30</td><td>—</td><td>2,90</td><td>ac</td><td>3,70</td> </tr> <tr> <td>1,13</td><td>1,30</td><td>—</td><td>1,80</td><td>—</td><td>2,30</td><td>—</td><td>2,90</td><td>ac</td><td>3,70</td> </tr> <tr> <td>1,25</td><td>1,30</td><td>—</td><td>1,80</td><td>—</td><td>2,30</td><td>—</td><td>2,90</td><td>ac</td><td>3,70</td> </tr> <tr> <td>1,50</td><td>1,30</td><td>—</td><td>1,90</td><td>—</td><td>2,70</td><td>—</td><td>3,60</td><td>—</td><td>—</td> </tr> <tr> <td>1,75</td><td>1,30</td><td>—</td><td>1,90</td><td>—</td><td>2,70</td><td>—</td><td>3,60</td><td>—</td><td>—</td> </tr> <tr> <td>2,00</td><td>1,30</td><td>—</td><td>1,90</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td rowspan="10">N_{0,x} [kN]</td> <td>0,50</td><td>0,43</td><td>—</td><td>0,54</td><td>—</td><td>0,70</td><td>—</td><td>0,81</td><td>ac</td><td>1,13</td> </tr> <tr> <td>0,55</td><td>0,55</td><td>—</td><td>0,68</td><td>—</td><td>0,89</td><td>—</td><td>1,02</td><td>ac</td><td>1,43</td> </tr> <tr> <td>0,63</td><td>0,80</td><td>—</td><td>1,00</td><td>—</td><td>1,30</td><td>—</td><td>1,50</td><td>ac</td><td>2,10</td> </tr> <tr> <td>0,75</td><td>0,80</td><td>—</td><td>1,00</td><td>—</td><td>1,30</td><td>—</td><td>1,50</td><td>ac</td><td>2,70</td> </tr> <tr> <td>0,88</td><td>0,80</td><td>—</td><td>1,00</td><td>—</td><td>1,30</td><td>—</td><td>1,50</td><td>ac</td><td>2,70</td> </tr> <tr> <td>1,00</td><td>0,80</td><td>—</td><td>1,00</td><td>—</td><td>1,30</td><td>—</td><td>1,50</td><td>ac</td><td>2,70</td> </tr> <tr> <td>1,13</td><td>0,80</td><td>—</td><td>1,00</td><td>—</td><td>1,30</td><td>—</td><td>1,50</td><td>ac</td><td>2,70</td> </tr> <tr> <td>1,25</td><td>0,80</td><td>—</td><td>1,00</td><td>—</td><td>1,30</td><td>—</td><td>1,50</td><td>ac</td><td>2,70</td> </tr> <tr> <td>1,50</td><td>0,80</td><td>—</td><td>1,00</td><td>—</td><td>1,30</td><td>—</td><td>1,50</td><td>—</td><td>—</td> </tr> <tr> <td>1,75</td><td>0,80</td><td>—</td><td>1,00</td><td>—</td><td>1,30</td><td>—</td><td>1,50</td><td>—</td><td>—</td> </tr> <tr> <td>2,00</td><td>0,80</td><td>—</td><td>1,00</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td>M_{0,25} [Nm]</td> <td colspan="5">$\Sigma t_i \leq 1,25$ mm: 2 Nm</td> <td colspan="5">$\Sigma t_i > 1,25$ mm: 5 Nm</td> </tr> </tbody> </table>										t [mm]	t _i [mm]									0,63	0,75	0,88	1,00	1,13	1,25	1,50	2,00		V _{0,x} [kN]	0,50	—	—	—	—	—	—	—	—	—	0,55	—	—	—	—	—	—	—	—	—	0,63	1,30	—	1,80	—	2,30	—	2,90	ac	2,90	0,75	1,30	—	1,80	—	2,30	—	2,90	ac	3,70	0,88	1,30	—	1,80	—	2,30	—	2,90	ac	3,70	1,00	1,30	—	1,80	—	2,30	—	2,90	ac	3,70	1,13	1,30	—	1,80	—	2,30	—	2,90	ac	3,70	1,25	1,30	—	1,80	—	2,30	—	2,90	ac	3,70	1,50	1,30	—	1,90	—	2,70	—	3,60	—	—	1,75	1,30	—	1,90	—	2,70	—	3,60	—	—	2,00	1,30	—	1,90	—	—	—	—	—	—	N _{0,x} [kN]	0,50	0,43	—	0,54	—	0,70	—	0,81	ac	1,13	0,55	0,55	—	0,68	—	0,89	—	1,02	ac	1,43	0,63	0,80	—	1,00	—	1,30	—	1,50	ac	2,10	0,75	0,80	—	1,00	—	1,30	—	1,50	ac	2,70	0,88	0,80	—	1,00	—	1,30	—	1,50	ac	2,70	1,00	0,80	—	1,00	—	1,30	—	1,50	ac	2,70	1,13	0,80	—	1,00	—	1,30	—	1,50	ac	2,70	1,25	0,80	—	1,00	—	1,30	—	1,50	ac	2,70	1,50	0,80	—	1,00	—	1,30	—	1,50	—	—	1,75	0,80	—	1,00	—	1,30	—	1,50	—	—	2,00	0,80	—	1,00	—	—	—	—	—	—	M _{0,25} [Nm]	$\Sigma t_i \leq 1,25$ mm: 2 Nm					$\Sigma t_i > 1,25$ mm: 5 Nm				
t [mm]	t _i [mm]																																																																																																																																																																																																																																																																				
	0,63	0,75	0,88	1,00	1,13	1,25	1,50	2,00																																																																																																																																																																																																																																																													
V _{0,x} [kN]	0,50	—	—	—	—	—	—	—	—	—																																																																																																																																																																																																																																																											
	0,55	—	—	—	—	—	—	—	—	—																																																																																																																																																																																																																																																											
	0,63	1,30	—	1,80	—	2,30	—	2,90	ac	2,90																																																																																																																																																																																																																																																											
	0,75	1,30	—	1,80	—	2,30	—	2,90	ac	3,70																																																																																																																																																																																																																																																											
	0,88	1,30	—	1,80	—	2,30	—	2,90	ac	3,70																																																																																																																																																																																																																																																											
	1,00	1,30	—	1,80	—	2,30	—	2,90	ac	3,70																																																																																																																																																																																																																																																											
	1,13	1,30	—	1,80	—	2,30	—	2,90	ac	3,70																																																																																																																																																																																																																																																											
	1,25	1,30	—	1,80	—	2,30	—	2,90	ac	3,70																																																																																																																																																																																																																																																											
	1,50	1,30	—	1,90	—	2,70	—	3,60	—	—																																																																																																																																																																																																																																																											
	1,75	1,30	—	1,90	—	2,70	—	3,60	—	—																																																																																																																																																																																																																																																											
2,00	1,30	—	1,90	—	—	—	—	—	—																																																																																																																																																																																																																																																												
N _{0,x} [kN]	0,50	0,43	—	0,54	—	0,70	—	0,81	ac	1,13																																																																																																																																																																																																																																																											
	0,55	0,55	—	0,68	—	0,89	—	1,02	ac	1,43																																																																																																																																																																																																																																																											
	0,63	0,80	—	1,00	—	1,30	—	1,50	ac	2,10																																																																																																																																																																																																																																																											
	0,75	0,80	—	1,00	—	1,30	—	1,50	ac	2,70																																																																																																																																																																																																																																																											
	0,88	0,80	—	1,00	—	1,30	—	1,50	ac	2,70																																																																																																																																																																																																																																																											
	1,00	0,80	—	1,00	—	1,30	—	1,50	ac	2,70																																																																																																																																																																																																																																																											
	1,13	0,80	—	1,00	—	1,30	—	1,50	ac	2,70																																																																																																																																																																																																																																																											
	1,25	0,80	—	1,00	—	1,30	—	1,50	ac	2,70																																																																																																																																																																																																																																																											
	1,50	0,80	—	1,00	—	1,30	—	1,50	—	—																																																																																																																																																																																																																																																											
	1,75	0,80	—	1,00	—	1,30	—	1,50	—	—																																																																																																																																																																																																																																																											
2,00	0,80	—	1,00	—	—	—	—	—	—																																																																																																																																																																																																																																																												
M _{0,25} [Nm]	$\Sigma t_i \leq 1,25$ mm: 2 Nm					$\Sigma t_i > 1,25$ mm: 5 Nm																																																																																																																																																																																																																																																															
No additional regulations.																																																																																																																																																																																																																																																																					
Self drilling screw																																																																																																																																																																																																																																																																					
Hilti S-MD 51 Z 4,8 x L Hilti S-MD 51 C 4,8 x L with hexagon head and sealing washer $\geq \phi 16$ mm								Annex 13																																																																																																																																																																																																																																																													

Annex 5:
ETA-10/0182, Annex 14

	<p>Material:</p> <p>Fastener: carbon steel, case hardened and galvanized or coated</p> <p>Washer: none</p> <p>Component I: S280GD, S320GD - EN 10346</p> <p>Component II: S280GD, S320GD - EN 10346 S235 - EN 10025-1</p>																																																																																																																																																																																																																																																						
	<p>Drilling capacity: $\Sigma t_i \leq 3,00$ mm</p>																																																																																																																																																																																																																																																						
<p>Timber substructures: no performance determined</p>																																																																																																																																																																																																																																																							
<table border="1"> <thead> <tr> <th rowspan="2">t [mm]</th> <th colspan="8">t_i [mm]</th> </tr> <tr> <th>0,63</th> <th>0,75</th> <th>0,88</th> <th>1,00</th> <th>1,13</th> <th>1,25</th> <th>1,50</th> <th>2,00</th> </tr> </thead> <tbody> <tr> <td>$V_{k,x}$ [kN]</td> <td>0,50</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td></td> <td>0,55</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td></td> <td>0,63</td><td>1,50</td><td>—</td><td>1,80</td><td>—</td><td>2,00</td><td>—</td><td>2,10</td><td>—</td> </tr> <tr> <td></td> <td>0,75</td><td>1,80</td><td>—</td><td>2,00</td><td>—</td><td>2,50</td><td>—</td><td>2,90</td><td>—</td> </tr> <tr> <td></td> <td>0,88</td><td>1,70</td><td>—</td><td>2,10</td><td>—</td><td>2,60</td><td>—</td><td>3,00</td><td>—</td> </tr> <tr> <td></td> <td>1,00</td><td>1,90</td><td>—</td><td>2,30</td><td>—</td><td>2,80</td><td>—</td><td>3,20</td><td>—</td> </tr> <tr> <td></td> <td>1,13</td><td>2,70</td><td>—</td><td>3,10</td><td>—</td><td>3,60</td><td>—</td><td>3,90</td><td>—</td> </tr> <tr> <td></td> <td>1,25</td><td>3,50</td><td>—</td><td>3,90</td><td>—</td><td>4,30</td><td>—</td><td>4,60</td><td>—</td> </tr> <tr> <td></td> <td>1,50</td><td>3,50</td><td>—</td><td>3,90</td><td>—</td><td>4,30</td><td>—</td><td>4,60</td><td>—</td> </tr> <tr> <td></td> <td>1,75</td><td>3,50</td><td>—</td><td>3,90</td><td>—</td><td>4,30</td><td>—</td><td>4,60</td><td>—</td> </tr> <tr> <td></td> <td>2,00</td><td>3,50</td><td>—</td><td>3,90</td><td>—</td><td>4,30</td><td>—</td><td>4,60</td><td>—</td> </tr> <tr> <td>$N_{k,x}$ [kN]</td> <td>0,50</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td></td> <td>0,55</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td></td> <td>0,63</td><td>0,90</td><td>—</td><td>1,20</td><td>—</td><td>1,50</td><td>—</td><td>1,70</td><td>—</td> </tr> <tr> <td></td> <td>0,75</td><td>0,90</td><td>—</td><td>1,20</td><td>—</td><td>1,50</td><td>—</td><td>1,80</td><td>—</td> </tr> <tr> <td></td> <td>0,88</td><td>0,90</td><td>—</td><td>1,20</td><td>—</td><td>1,50</td><td>—</td><td>1,80</td><td>—</td> </tr> <tr> <td></td> <td>1,00</td><td>0,90</td><td>—</td><td>1,20</td><td>—</td><td>1,50</td><td>—</td><td>1,80</td><td>—</td> </tr> <tr> <td></td> <td>1,13</td><td>0,90</td><td>—</td><td>1,20</td><td>—</td><td>1,50</td><td>—</td><td>1,80</td><td>—</td> </tr> <tr> <td></td> <td>1,25</td><td>0,90</td><td>—</td><td>1,20</td><td>—</td><td>1,50</td><td>—</td><td>1,80</td><td>—</td> </tr> <tr> <td></td> <td>1,50</td><td>0,90</td><td>—</td><td>1,20</td><td>—</td><td>1,50</td><td>—</td><td>1,80</td><td>—</td> </tr> <tr> <td></td> <td>1,75</td><td>0,90</td><td>—</td><td>1,20</td><td>—</td><td>1,50</td><td>—</td><td>1,80</td><td>—</td> </tr> <tr> <td></td> <td>2,00</td><td>0,90</td><td>—</td><td>1,20</td><td>—</td><td>1,50</td><td>—</td><td>1,80</td><td>—</td> </tr> <tr> <td>$M_{t,adm}$ [Nm]</td> <td colspan="4">$\Sigma t \leq 1,25$ mm: 3 Nm</td> <td colspan="4">$\Sigma t > 1,25$ mm: 6 Nm</td> </tr> </tbody> </table>	t [mm]	t_i [mm]								0,63	0,75	0,88	1,00	1,13	1,25	1,50	2,00	$V_{k,x}$ [kN]	0,50	—	—	—	—	—	—	—	—		0,55	—	—	—	—	—	—	—	—		0,63	1,50	—	1,80	—	2,00	—	2,10	—		0,75	1,80	—	2,00	—	2,50	—	2,90	—		0,88	1,70	—	2,10	—	2,60	—	3,00	—		1,00	1,90	—	2,30	—	2,80	—	3,20	—		1,13	2,70	—	3,10	—	3,60	—	3,90	—		1,25	3,50	—	3,90	—	4,30	—	4,60	—		1,50	3,50	—	3,90	—	4,30	—	4,60	—		1,75	3,50	—	3,90	—	4,30	—	4,60	—		2,00	3,50	—	3,90	—	4,30	—	4,60	—	$N_{k,x}$ [kN]	0,50	—	—	—	—	—	—	—	—		0,55	—	—	—	—	—	—	—	—		0,63	0,90	—	1,20	—	1,50	—	1,70	—		0,75	0,90	—	1,20	—	1,50	—	1,80	—		0,88	0,90	—	1,20	—	1,50	—	1,80	—		1,00	0,90	—	1,20	—	1,50	—	1,80	—		1,13	0,90	—	1,20	—	1,50	—	1,80	—		1,25	0,90	—	1,20	—	1,50	—	1,80	—		1,50	0,90	—	1,20	—	1,50	—	1,80	—		1,75	0,90	—	1,20	—	1,50	—	1,80	—		2,00	0,90	—	1,20	—	1,50	—	1,80	—	$M_{t,adm}$ [Nm]	$\Sigma t \leq 1,25$ mm: 3 Nm				$\Sigma t > 1,25$ mm: 6 Nm				
t [mm]		t_i [mm]																																																																																																																																																																																																																																																					
	0,63	0,75	0,88	1,00	1,13	1,25	1,50	2,00																																																																																																																																																																																																																																															
$V_{k,x}$ [kN]	0,50	—	—	—	—	—	—	—	—																																																																																																																																																																																																																																														
	0,55	—	—	—	—	—	—	—	—																																																																																																																																																																																																																																														
	0,63	1,50	—	1,80	—	2,00	—	2,10	—																																																																																																																																																																																																																																														
	0,75	1,80	—	2,00	—	2,50	—	2,90	—																																																																																																																																																																																																																																														
	0,88	1,70	—	2,10	—	2,60	—	3,00	—																																																																																																																																																																																																																																														
	1,00	1,90	—	2,30	—	2,80	—	3,20	—																																																																																																																																																																																																																																														
	1,13	2,70	—	3,10	—	3,60	—	3,90	—																																																																																																																																																																																																																																														
	1,25	3,50	—	3,90	—	4,30	—	4,60	—																																																																																																																																																																																																																																														
	1,50	3,50	—	3,90	—	4,30	—	4,60	—																																																																																																																																																																																																																																														
	1,75	3,50	—	3,90	—	4,30	—	4,60	—																																																																																																																																																																																																																																														
	2,00	3,50	—	3,90	—	4,30	—	4,60	—																																																																																																																																																																																																																																														
$N_{k,x}$ [kN]	0,50	—	—	—	—	—	—	—	—																																																																																																																																																																																																																																														
	0,55	—	—	—	—	—	—	—	—																																																																																																																																																																																																																																														
	0,63	0,90	—	1,20	—	1,50	—	1,70	—																																																																																																																																																																																																																																														
	0,75	0,90	—	1,20	—	1,50	—	1,80	—																																																																																																																																																																																																																																														
	0,88	0,90	—	1,20	—	1,50	—	1,80	—																																																																																																																																																																																																																																														
	1,00	0,90	—	1,20	—	1,50	—	1,80	—																																																																																																																																																																																																																																														
	1,13	0,90	—	1,20	—	1,50	—	1,80	—																																																																																																																																																																																																																																														
	1,25	0,90	—	1,20	—	1,50	—	1,80	—																																																																																																																																																																																																																																														
	1,50	0,90	—	1,20	—	1,50	—	1,80	—																																																																																																																																																																																																																																														
	1,75	0,90	—	1,20	—	1,50	—	1,80	—																																																																																																																																																																																																																																														
	2,00	0,90	—	1,20	—	1,50	—	1,80	—																																																																																																																																																																																																																																														
$M_{t,adm}$ [Nm]	$\Sigma t \leq 1,25$ mm: 3 Nm				$\Sigma t > 1,25$ mm: 6 Nm																																																																																																																																																																																																																																																		
No additional regulations.																																																																																																																																																																																																																																																							
Self drilling screw		Annex 14																																																																																																																																																																																																																																																					
Hilti S-MD 01 Z 5,5 x L Hilti S-MD 01 C 5,5 x L with hexagon head																																																																																																																																																																																																																																																							

Annex 6:
ETA-10/0182, Annex 15

Material:
Fastener: carbon steel, case hardened and galvanized or coated
Washer: carbon steel, galvanized or coated stainless Steel (1.4301) - EN 10088
Component I: S280GD, S320GD - EN 10346
Component II: S280GD, S320GD - EN 10346 S235 - EN 10025-1

Drilling capacity: $\Sigma t_i \leq 3,00 \text{ mm}$

Timber substructures:
no performance determined

t [mm]	t_i [mm]									
	0,63	0,75	0,88	1,00	1,13	1,25	1,50	2,00		
$V_{0,5}$ [kN]	0,50	0,55	0,63	0,75	0,88	1,00	1,13	1,25	1,50	2,00
$N_{0,5}$ [kN]	0,50	0,55	0,63	0,75	0,88	1,00	1,13	1,25	1,50	2,00
$M_{0,5}$ [Nm]	$\Sigma t \leq 1,25 \text{ mm}: 3 \text{ Nm}$					$\Sigma t > 1,25 \text{ mm}: 6 \text{ Nm}$				

No additional regulations.

Self drilling screw

Hilti S-MD 51 Z 5,5 x L
Hilti S-MD 51 C 5,5 x L
with hexagon head and sealing washer $\geq \text{Ø}16 \text{ mm}$

Annex 15

Annex 7:
ETA-10/0182, Annex 16

	<p>Material:</p> <p>Fastener: carbon steel, case hardened and galvanized or coated</p> <p>Washer: none</p> <p>Component I: S280GD, S320GD - EN 10346</p> <p>Component II: S280GD, S320GD - EN 10346 S235 - EN 10025-1</p>																																														
<p>Drilling capacity: $\Sigma t_i \leq 3,00$ mm</p>																																															
<p>Timber substructures: no performance determined</p>																																															
<table border="1"> <thead> <tr> <th>t_i [mm]</th> <th>0,63</th> <th>0,75</th> <th>0,88</th> <th>1,00</th> <th>1,13</th> <th>1,25</th> <th>1,50</th> <th>2,00</th> </tr> </thead> <tbody> <tr> <td>$N_{t,k}$ [kN]</td> <td>0,50 — — — — — — — —</td> <td>0,55 — — — — — — — —</td> <td>0,63 1,50 — 2,00 — 2,50 — 2,90 — 3,50 — 3,70 ac 3,70 ac 3,70 ac</td> <td>0,75 1,90 — 2,30 — 2,80 — 3,30 — 3,80 — 4,30 — 4,80 ac 4,80 ac 4,80 ac</td> <td>0,88 2,00 — 2,40 — 2,90 — 3,30 — 3,80 — 4,30 — 5,10 — 6,00 a 6,00 a</td> <td>1,00 2,10 — 2,50 — 3,00 — 3,40 — 3,90 — 4,40 — 5,40 — 7,20 — 7,20 —</td> <td>1,13 2,10 — 2,50 — 3,10 — 3,60 — 4,20 — 4,80 — 6,00 — — — —</td> <td>1,25 2,10 — 2,60 — 3,30 — 3,90 — 4,60 — 5,20 — 6,70 — — — —</td> <td>1,50 2,10 — 2,60 — 3,30 — 3,90 — 4,60 — 5,20 — 6,70 — — — —</td> <td>1,75 2,10 — 2,60 — 3,30 — 3,90 — 4,60 — 5,20 — — — — — —</td> <td>2,00 2,10 — 2,60 — 3,30 — 3,90 — — — — — — — — — —</td> </tr> <tr> <td>$N_{e,k}$ [kN]</td> <td>0,50 — — — — — — — —</td> <td>0,55 — — — — — — — —</td> <td>0,63 0,90 — 1,20 — 1,50 — 1,80 — 1,90 — 1,90 ac 1,90 ac 1,90 ac</td> <td>0,75 0,90 — 1,20 — 1,50 — 1,80 — 2,10 — 2,40 — 2,40 ac 2,40 ac 2,40 ac</td> <td>0,88 0,90 — 1,20 — 1,50 — 1,80 — 2,10 — 2,40 — 3,10 — 3,40 a 3,40 a</td> <td>1,00 0,90 — 1,20 — 1,50 — 1,80 — 2,10 — 2,40 — 3,10 — 4,30 — 4,30 —</td> <td>1,13 0,90 — 1,20 — 1,50 — 1,80 — 2,10 — 2,40 — 3,10 — — — —</td> <td>1,25 0,90 — 1,20 — 1,50 — 1,80 — 2,10 — 2,40 — 3,10 — — — —</td> <td>1,50 0,90 — 1,20 — 1,50 — 1,80 — 2,10 — 2,40 — 3,10 — — — —</td> <td>1,75 0,90 — 1,20 — 1,50 — 1,80 — 2,10 — 2,40 — — — — — —</td> <td>2,00 0,90 — 1,20 — 1,50 — 1,80 — — — — — — — — — —</td> </tr> <tr> <td>$M_{t,adm}$ [Nm]</td> <td colspan="6">$\Sigma t_i \leq 1,25$ mm: 4 Nm</td> <td colspan="6">$\Sigma t_i > 1,25$ mm: 8 Nm</td> </tr> </tbody> </table>		t_i [mm]	0,63	0,75	0,88	1,00	1,13	1,25	1,50	2,00	$N_{t,k}$ [kN]	0,50 — — — — — — — —	0,55 — — — — — — — —	0,63 1,50 — 2,00 — 2,50 — 2,90 — 3,50 — 3,70 ac 3,70 ac 3,70 ac	0,75 1,90 — 2,30 — 2,80 — 3,30 — 3,80 — 4,30 — 4,80 ac 4,80 ac 4,80 ac	0,88 2,00 — 2,40 — 2,90 — 3,30 — 3,80 — 4,30 — 5,10 — 6,00 a 6,00 a	1,00 2,10 — 2,50 — 3,00 — 3,40 — 3,90 — 4,40 — 5,40 — 7,20 — 7,20 —	1,13 2,10 — 2,50 — 3,10 — 3,60 — 4,20 — 4,80 — 6,00 — — — —	1,25 2,10 — 2,60 — 3,30 — 3,90 — 4,60 — 5,20 — 6,70 — — — —	1,50 2,10 — 2,60 — 3,30 — 3,90 — 4,60 — 5,20 — 6,70 — — — —	1,75 2,10 — 2,60 — 3,30 — 3,90 — 4,60 — 5,20 — — — — — —	2,00 2,10 — 2,60 — 3,30 — 3,90 — — — — — — — — — —	$N_{e,k}$ [kN]	0,50 — — — — — — — —	0,55 — — — — — — — —	0,63 0,90 — 1,20 — 1,50 — 1,80 — 1,90 — 1,90 ac 1,90 ac 1,90 ac	0,75 0,90 — 1,20 — 1,50 — 1,80 — 2,10 — 2,40 — 2,40 ac 2,40 ac 2,40 ac	0,88 0,90 — 1,20 — 1,50 — 1,80 — 2,10 — 2,40 — 3,10 — 3,40 a 3,40 a	1,00 0,90 — 1,20 — 1,50 — 1,80 — 2,10 — 2,40 — 3,10 — 4,30 — 4,30 —	1,13 0,90 — 1,20 — 1,50 — 1,80 — 2,10 — 2,40 — 3,10 — — — —	1,25 0,90 — 1,20 — 1,50 — 1,80 — 2,10 — 2,40 — 3,10 — — — —	1,50 0,90 — 1,20 — 1,50 — 1,80 — 2,10 — 2,40 — 3,10 — — — —	1,75 0,90 — 1,20 — 1,50 — 1,80 — 2,10 — 2,40 — — — — — —	2,00 0,90 — 1,20 — 1,50 — 1,80 — — — — — — — — — —	$M_{t,adm}$ [Nm]	$\Sigma t_i \leq 1,25$ mm: 4 Nm						$\Sigma t_i > 1,25$ mm: 8 Nm					
t_i [mm]	0,63	0,75	0,88	1,00	1,13	1,25	1,50	2,00																																							
$N_{t,k}$ [kN]	0,50 — — — — — — — —	0,55 — — — — — — — —	0,63 1,50 — 2,00 — 2,50 — 2,90 — 3,50 — 3,70 ac 3,70 ac 3,70 ac	0,75 1,90 — 2,30 — 2,80 — 3,30 — 3,80 — 4,30 — 4,80 ac 4,80 ac 4,80 ac	0,88 2,00 — 2,40 — 2,90 — 3,30 — 3,80 — 4,30 — 5,10 — 6,00 a 6,00 a	1,00 2,10 — 2,50 — 3,00 — 3,40 — 3,90 — 4,40 — 5,40 — 7,20 — 7,20 —	1,13 2,10 — 2,50 — 3,10 — 3,60 — 4,20 — 4,80 — 6,00 — — — —	1,25 2,10 — 2,60 — 3,30 — 3,90 — 4,60 — 5,20 — 6,70 — — — —	1,50 2,10 — 2,60 — 3,30 — 3,90 — 4,60 — 5,20 — 6,70 — — — —	1,75 2,10 — 2,60 — 3,30 — 3,90 — 4,60 — 5,20 — — — — — —	2,00 2,10 — 2,60 — 3,30 — 3,90 — — — — — — — — — —																																				
$N_{e,k}$ [kN]	0,50 — — — — — — — —	0,55 — — — — — — — —	0,63 0,90 — 1,20 — 1,50 — 1,80 — 1,90 — 1,90 ac 1,90 ac 1,90 ac	0,75 0,90 — 1,20 — 1,50 — 1,80 — 2,10 — 2,40 — 2,40 ac 2,40 ac 2,40 ac	0,88 0,90 — 1,20 — 1,50 — 1,80 — 2,10 — 2,40 — 3,10 — 3,40 a 3,40 a	1,00 0,90 — 1,20 — 1,50 — 1,80 — 2,10 — 2,40 — 3,10 — 4,30 — 4,30 —	1,13 0,90 — 1,20 — 1,50 — 1,80 — 2,10 — 2,40 — 3,10 — — — —	1,25 0,90 — 1,20 — 1,50 — 1,80 — 2,10 — 2,40 — 3,10 — — — —	1,50 0,90 — 1,20 — 1,50 — 1,80 — 2,10 — 2,40 — 3,10 — — — —	1,75 0,90 — 1,20 — 1,50 — 1,80 — 2,10 — 2,40 — — — — — —	2,00 0,90 — 1,20 — 1,50 — 1,80 — — — — — — — — — —																																				
$M_{t,adm}$ [Nm]	$\Sigma t_i \leq 1,25$ mm: 4 Nm						$\Sigma t_i > 1,25$ mm: 8 Nm																																								
<p>No additional regulations.</p>																																															
<p style="text-align: center;">Self drilling screw</p> <hr/> <p style="text-align: center;">Hilti S-MD 01 Z 6,3 x L Hilti S-MD 01 C 6,3 x L with hexagon head</p> <div style="float: right; text-align: right;">Annex 16</div>																																															

Annex 8:
ETA-10/0182, Annex 17

Material:

Fastener: carbon steel, case hardened and galvanized or coated

Washer: carbon steel, galvanized or coated
stainless Steel (1.4301) - EN 10088

Component I: S280GD, S320GD - EN 10346

Component II: S280GD, S320GD - EN 10346
S235 - EN 10025-1

Drilling capacity: $\Sigma t \leq 3,00 \text{ mm}$

Timber substructures:
no performance determined

t [mm]	t _i [mm]															
	0,63		0,75		0,88		1,00		1,13		1,25		1,50		2,00	
V_{0,3} [kN]	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—
0,50	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—
0,55	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—
0,63	1,60	—	2,10	—	2,70	—	3,30	—	3,30	ac	3,30	ac	3,30	ac	3,30	ac
0,75	1,60	—	2,10	—	2,70	—	3,30	—	4,10	—	4,20	ac	4,20	ac	4,20	a
0,88	1,70	—	2,20	—	2,80	—	3,40	—	4,10	—	4,40	—	5,20	ac	5,20	a
1,00	1,80	—	2,40	—	3,00	—	3,50	—	4,10	—	4,60	—	5,80	—	6,30	a
1,13	1,80	—	2,40	—	3,00	—	3,50	—	4,20	—	4,80	—	6,20	—	—	—
1,25	1,80	—	2,40	—	3,00	—	3,60	—	4,20	—	5,00	—	6,50	—	—	—
1,50	2,00	—	2,60	—	3,30	—	4,00	—	4,80	—	5,50	—	7,20	—	—	—
1,75	2,00	—	2,60	—	3,30	—	4,00	—	4,80	—	5,50	—	—	—	—	—
2,00	2,00	—	2,60	—	3,30	—	4,00	—	—	—	—	—	—	—	—	—
N_{0,3} [kN]	0,49	—	0,65	—	0,81	—	0,97	—	1,13	ac	1,30	ac	1,67	ac	1,73	ac
0,50	0,61	—	0,82	—	1,02	—	1,23	—	1,43	ac	1,64	ac	2,11	ac	2,18	ac
0,55	0,90	—	1,20	—	1,50	—	1,80	—	2,10	ac	2,40	ac	3,10	ac	3,20	ac
0,63	0,90	—	1,20	—	1,50	—	1,80	—	2,10	—	2,40	ac	3,10	ac	4,00	a
0,75	0,90	—	1,20	—	1,50	—	1,80	—	2,10	—	2,40	—	3,10	ac	4,60	a
0,88	0,90	—	1,20	—	1,50	—	1,80	—	2,10	—	2,40	—	3,10	—	4,60	a
1,00	0,90	—	1,20	—	1,50	—	1,80	—	2,10	—	2,40	—	3,10	—	4,60	a
1,13	0,90	—	1,20	—	1,50	—	1,80	—	2,10	—	2,40	—	3,10	—	—	—
1,25	0,90	—	1,20	—	1,50	—	1,80	—	2,10	—	2,40	—	3,10	—	—	—
1,50	0,90	—	1,20	—	1,50	—	1,80	—	2,10	—	2,40	—	3,10	—	—	—
1,75	0,90	—	1,20	—	1,50	—	1,80	—	2,10	—	2,40	—	—	—	—	—
2,00	0,90	—	1,20	—	1,50	—	1,80	—	—	—	—	—	—	—	—	—
M_{nom} [Nm]	$\Sigma t \leq 1,25 \text{ mm: } 4 \text{ Nm}$								$\Sigma t > 1,25 \text{ mm: } 8 \text{ Nm}$							

No additional regulations.

Self drilling screw	Annex 17
Hilti S-MD 51 Z 6,3 x L Hilti S-MD 51 C 6,3 x L with hexagon head and sealing washer $\geq \varnothing 16 \text{ mm}$	

Annex 9:
ETA-10/0182, Annex 18

	<p>Material:</p> <p>Fastener: carbon steel, case hardened and galvanized or coated</p> <p>Washer: none</p> <p>Component I: S280GD, S320GD, S350GD, S390GD - EN 10346</p> <p>Component II: S280GD, S320GD, S350GD, S390GD - EN 10346 S235, S275, S355 - EN 10025-1</p>																																																																																																																																																																																																																																																																																																																				
	<p>Drilling capacity: $\Sigma t_i \leq 2,75$ mm</p>																																																																																																																																																																																																																																																																																																																				
<p>Timber substructures: no performance determined</p>																																																																																																																																																																																																																																																																																																																					
<table border="1"> <thead> <tr> <th rowspan="2"></th> <th rowspan="2">t [mm]</th> <th colspan="10">t_i [mm]</th> </tr> <tr> <th>0,40</th> <th>0,50</th> <th>0,63</th> <th>0,75</th> <th>0,88</th> <th>1,00</th> <th>1,13</th> <th>1,25</th> <th>1,50</th> <th>2,00</th> </tr> </thead> <tbody> <tr> <td rowspan="11">V_{0,2} [kN]</td> <td>0,40</td> <td>0,68</td> <td>0,68</td> <td>0,68</td> <td>0,68</td> <td>0,68</td> <td>0,68</td> <td>0,68</td> <td>0,68</td> <td>0,68</td> <td>0,68</td> </tr> <tr> <td>0,50</td> <td>0,68</td> <td>1,03</td> <td>1,03</td> <td>1,03</td> <td>1,03</td> <td>1,03</td> <td>1,03</td> <td>1,03</td> <td>1,03</td> <td>1,03</td> </tr> <tr> <td>0,55</td> <td>0,68</td> <td>1,03</td> <td>1,23</td> <td>1,23</td> <td>1,23</td> <td>1,23</td> <td>1,23</td> <td>1,23</td> <td>1,23</td> <td>1,23</td> </tr> <tr> <td>0,63</td> <td>0,68</td> <td>1,03</td> <td>1,55</td> <td>1,55</td> <td>1,55</td> <td>1,55</td> <td>1,55</td> <td>1,55</td> <td>1,55</td> <td>1,55</td> </tr> <tr> <td>0,75</td> <td>0,68</td> <td>1,03</td> <td>1,55</td> <td>2,03</td> <td>2,03</td> <td>2,03</td> <td>2,03</td> <td>2,03</td> <td>2,03</td> <td>2,03</td> </tr> <tr> <td>0,88</td> <td>0,68</td> <td>1,03</td> <td>1,55</td> <td>2,03</td> <td>2,38</td> <td>2,38</td> <td>2,38</td> <td>2,38</td> <td>2,38</td> <td>—</td> </tr> <tr> <td>1,00</td> <td>0,68</td> <td>1,03</td> <td>1,55</td> <td>2,03</td> <td>2,38</td> <td>2,71</td> <td>2,71</td> <td>2,71</td> <td>2,71</td> <td>—</td> </tr> <tr> <td>1,13</td> <td>0,68</td> <td>1,03</td> <td>1,55</td> <td>2,03</td> <td>2,38</td> <td>2,71</td> <td>2,71</td> <td>2,71</td> <td>2,71</td> <td>—</td> </tr> <tr> <td>1,25</td> <td>0,68</td> <td>1,03</td> <td>1,55</td> <td>2,03</td> <td>2,38</td> <td>2,71</td> <td>2,71</td> <td>2,71</td> <td>2,71</td> <td>—</td> </tr> <tr> <td>1,50</td> <td>0,68</td> <td>1,03</td> <td>1,55</td> <td>2,03</td> <td>2,38</td> <td>2,71</td> <td>2,71</td> <td>2,71</td> <td>—</td> <td>—</td> </tr> <tr> <td>1,75</td> <td>0,68</td> <td>1,03</td> <td>1,55</td> <td>2,03</td> <td>2,38</td> <td>2,71</td> <td>—</td> <td>—</td> <td>—</td> <td>—</td> </tr> <tr> <td>2,00</td> <td>0,68</td> <td>1,03</td> <td>1,55</td> <td>2,03</td> <td>—</td> <td>—</td> <td>—</td> <td>—</td> <td>—</td> <td>—</td> </tr> <tr> <td rowspan="11">N_{0,2} [kN]</td> <td>0,40</td> <td>0,46</td> <td>0,70</td> <td>0,77</td> <td>1,04</td> <td>1,04</td> <td>1,04</td> <td>1,04</td> <td>1,04</td> <td>1,04</td> <td>1,04</td> </tr> <tr> <td>0,50</td> <td>0,46</td> <td>0,70</td> <td>0,77</td> <td>1,11</td> <td>1,25</td> <td>1,25</td> <td>1,25</td> <td>1,25</td> <td>1,25</td> <td>1,25</td> </tr> <tr> <td>0,55</td> <td>0,46</td> <td>0,70</td> <td>0,77</td> <td>1,11</td> <td>1,33</td> <td>1,33</td> <td>1,33</td> <td>1,33</td> <td>1,33</td> <td>1,33</td> </tr> <tr> <td>0,63</td> <td>0,46</td> <td>0,70</td> <td>0,77</td> <td>1,11</td> <td>1,40</td> <td>1,40</td> <td>1,40</td> <td>1,40</td> <td>1,40</td> <td>1,40</td> </tr> <tr> <td>0,75</td> <td>0,46</td> <td>0,70</td> <td>0,77</td> <td>1,11</td> <td>1,40</td> <td>1,69</td> <td>2,00</td> <td>2,00</td> <td>2,00</td> <td>2,00</td> </tr> <tr> <td>0,88</td> <td>0,46</td> <td>0,70</td> <td>0,77</td> <td>1,11</td> <td>1,40</td> <td>1,69</td> <td>2,10</td> <td>2,48</td> <td>2,70</td> <td>—</td> </tr> <tr> <td>1,00</td> <td>0,46</td> <td>0,70</td> <td>0,77</td> <td>1,11</td> <td>1,40</td> <td>1,69</td> <td>2,10</td> <td>2,48</td> <td>2,70</td> <td>—</td> </tr> <tr> <td>1,13</td> <td>0,46</td> <td>0,70</td> <td>0,77</td> <td>1,11</td> <td>1,40</td> <td>1,69</td> <td>2,10</td> <td>2,48</td> <td>2,70</td> <td>—</td> </tr> <tr> <td>1,25</td> <td>0,46</td> <td>0,70</td> <td>0,77</td> <td>1,11</td> <td>1,40</td> <td>1,69</td> <td>2,10</td> <td>2,48</td> <td>2,70</td> <td>—</td> </tr> <tr> <td>1,50</td> <td>0,46</td> <td>0,70</td> <td>0,77</td> <td>1,11</td> <td>1,40</td> <td>1,69</td> <td>2,10</td> <td>2,48</td> <td>—</td> <td>—</td> </tr> <tr> <td>1,75</td> <td>0,46</td> <td>0,70</td> <td>0,77</td> <td>1,11</td> <td>1,40</td> <td>1,69</td> <td>—</td> <td>—</td> <td>—</td> <td>—</td> </tr> <tr> <td>2,00</td> <td>0,46</td> <td>0,70</td> <td>0,77</td> <td>1,11</td> <td>—</td> <td>—</td> <td>—</td> <td>—</td> <td>—</td> <td>—</td> </tr> <tr> <td colspan="11">M_{0,2} [Nm]</td> </tr> </tbody> </table>												t [mm]	t _i [mm]										0,40	0,50	0,63	0,75	0,88	1,00	1,13	1,25	1,50	2,00	V _{0,2} [kN]	0,40	0,68	0,68	0,68	0,68	0,68	0,68	0,68	0,68	0,68	0,68	0,50	0,68	1,03	1,03	1,03	1,03	1,03	1,03	1,03	1,03	1,03	0,55	0,68	1,03	1,23	1,23	1,23	1,23	1,23	1,23	1,23	1,23	0,63	0,68	1,03	1,55	1,55	1,55	1,55	1,55	1,55	1,55	1,55	0,75	0,68	1,03	1,55	2,03	2,03	2,03	2,03	2,03	2,03	2,03	0,88	0,68	1,03	1,55	2,03	2,38	2,38	2,38	2,38	2,38	—	1,00	0,68	1,03	1,55	2,03	2,38	2,71	2,71	2,71	2,71	—	1,13	0,68	1,03	1,55	2,03	2,38	2,71	2,71	2,71	2,71	—	1,25	0,68	1,03	1,55	2,03	2,38	2,71	2,71	2,71	2,71	—	1,50	0,68	1,03	1,55	2,03	2,38	2,71	2,71	2,71	—	—	1,75	0,68	1,03	1,55	2,03	2,38	2,71	—	—	—	—	2,00	0,68	1,03	1,55	2,03	—	—	—	—	—	—	N _{0,2} [kN]	0,40	0,46	0,70	0,77	1,04	1,04	1,04	1,04	1,04	1,04	1,04	0,50	0,46	0,70	0,77	1,11	1,25	1,25	1,25	1,25	1,25	1,25	0,55	0,46	0,70	0,77	1,11	1,33	1,33	1,33	1,33	1,33	1,33	0,63	0,46	0,70	0,77	1,11	1,40	1,40	1,40	1,40	1,40	1,40	0,75	0,46	0,70	0,77	1,11	1,40	1,69	2,00	2,00	2,00	2,00	0,88	0,46	0,70	0,77	1,11	1,40	1,69	2,10	2,48	2,70	—	1,00	0,46	0,70	0,77	1,11	1,40	1,69	2,10	2,48	2,70	—	1,13	0,46	0,70	0,77	1,11	1,40	1,69	2,10	2,48	2,70	—	1,25	0,46	0,70	0,77	1,11	1,40	1,69	2,10	2,48	2,70	—	1,50	0,46	0,70	0,77	1,11	1,40	1,69	2,10	2,48	—	—	1,75	0,46	0,70	0,77	1,11	1,40	1,69	—	—	—	—	2,00	0,46	0,70	0,77	1,11	—	—	—	—	—	—	M _{0,2} [Nm]										
	t [mm]	t _i [mm]																																																																																																																																																																																																																																																																																																																			
		0,40	0,50	0,63	0,75	0,88	1,00	1,13	1,25	1,50	2,00																																																																																																																																																																																																																																																																																																										
V _{0,2} [kN]	0,40	0,68	0,68	0,68	0,68	0,68	0,68	0,68	0,68	0,68	0,68																																																																																																																																																																																																																																																																																																										
	0,50	0,68	1,03	1,03	1,03	1,03	1,03	1,03	1,03	1,03	1,03																																																																																																																																																																																																																																																																																																										
	0,55	0,68	1,03	1,23	1,23	1,23	1,23	1,23	1,23	1,23	1,23																																																																																																																																																																																																																																																																																																										
	0,63	0,68	1,03	1,55	1,55	1,55	1,55	1,55	1,55	1,55	1,55																																																																																																																																																																																																																																																																																																										
	0,75	0,68	1,03	1,55	2,03	2,03	2,03	2,03	2,03	2,03	2,03																																																																																																																																																																																																																																																																																																										
	0,88	0,68	1,03	1,55	2,03	2,38	2,38	2,38	2,38	2,38	—																																																																																																																																																																																																																																																																																																										
	1,00	0,68	1,03	1,55	2,03	2,38	2,71	2,71	2,71	2,71	—																																																																																																																																																																																																																																																																																																										
	1,13	0,68	1,03	1,55	2,03	2,38	2,71	2,71	2,71	2,71	—																																																																																																																																																																																																																																																																																																										
	1,25	0,68	1,03	1,55	2,03	2,38	2,71	2,71	2,71	2,71	—																																																																																																																																																																																																																																																																																																										
	1,50	0,68	1,03	1,55	2,03	2,38	2,71	2,71	2,71	—	—																																																																																																																																																																																																																																																																																																										
	1,75	0,68	1,03	1,55	2,03	2,38	2,71	—	—	—	—																																																																																																																																																																																																																																																																																																										
2,00	0,68	1,03	1,55	2,03	—	—	—	—	—	—																																																																																																																																																																																																																																																																																																											
N _{0,2} [kN]	0,40	0,46	0,70	0,77	1,04	1,04	1,04	1,04	1,04	1,04	1,04																																																																																																																																																																																																																																																																																																										
	0,50	0,46	0,70	0,77	1,11	1,25	1,25	1,25	1,25	1,25	1,25																																																																																																																																																																																																																																																																																																										
	0,55	0,46	0,70	0,77	1,11	1,33	1,33	1,33	1,33	1,33	1,33																																																																																																																																																																																																																																																																																																										
	0,63	0,46	0,70	0,77	1,11	1,40	1,40	1,40	1,40	1,40	1,40																																																																																																																																																																																																																																																																																																										
	0,75	0,46	0,70	0,77	1,11	1,40	1,69	2,00	2,00	2,00	2,00																																																																																																																																																																																																																																																																																																										
	0,88	0,46	0,70	0,77	1,11	1,40	1,69	2,10	2,48	2,70	—																																																																																																																																																																																																																																																																																																										
	1,00	0,46	0,70	0,77	1,11	1,40	1,69	2,10	2,48	2,70	—																																																																																																																																																																																																																																																																																																										
	1,13	0,46	0,70	0,77	1,11	1,40	1,69	2,10	2,48	2,70	—																																																																																																																																																																																																																																																																																																										
	1,25	0,46	0,70	0,77	1,11	1,40	1,69	2,10	2,48	2,70	—																																																																																																																																																																																																																																																																																																										
	1,50	0,46	0,70	0,77	1,11	1,40	1,69	2,10	2,48	—	—																																																																																																																																																																																																																																																																																																										
	1,75	0,46	0,70	0,77	1,11	1,40	1,69	—	—	—	—																																																																																																																																																																																																																																																																																																										
2,00	0,46	0,70	0,77	1,11	—	—	—	—	—	—																																																																																																																																																																																																																																																																																																											
M _{0,2} [Nm]																																																																																																																																																																																																																																																																																																																					
No additional regulations.																																																																																																																																																																																																																																																																																																																					
Self drilling screw										Annex 18																																																																																																																																																																																																																																																																																																											
Hilti S-MD 01 LZ 4,8 x L Hilti S-MD 01 LC 4,8 x L with hexagon head																																																																																																																																																																																																																																																																																																																					

Annex 10:
ETA-10/0182, Annex 19

Material:
Fastener: carbon steel, case hardened and galvanized or coated
Washer: none
Component I: S280GD, S320GD - EN 10346
Component II: S280GD, S320GD - EN 10346
S235 - EN 10025-1

Drilling capacity: $\Sigma t_i \leq 6,00$ mm

Timber substructures:
no performance determined

t_i [mm]	t_i [mm]																		
	0,63	0,75	0,88	1,00	1,50	2,00	3,00	4,00	5,00										
V_{Rk} [kN]	0,50	—	—	—	—	—	—	—	—	—									
	0,55	—	—	—	—	—	—	—	—	—									
	0,63	1,29	—	1,29	—	1,74	—	2,30	ac	2,70	ac	2,70	ac	2,70	ac				
	0,75	1,29	—	2,02	—	2,17	—	2,30	—	3,00	—	3,80	ac	3,80	ac	3,80	ac		
	0,88	1,29	—	2,02	—	2,26	—	2,34	—	2,80	—	3,50	—	4,90	—	4,90	—	4,90	—
	1,00	1,29	—	2,02	—	2,26	—	2,49	—	2,90	—	4,00	—	6,00	—	6,00	—	6,00	—
	1,13	1,29	—	2,02	—	2,26	—	2,49	—	3,50	—	4,80	—	6,80	—	6,80	—	—	—
	1,25	1,29	—	2,02	—	2,26	—	2,49	—	4,10	—	5,20	—	7,10	—	7,10	—	—	—
	1,50	1,29	—	2,02	—	2,26	—	2,49	—	5,20	—	6,00	—	7,30	—	7,30	—	—	—
	1,75	1,29	—	2,02	—	2,26	—	2,49	—	5,20	—	6,00	—	7,30	—	7,30	—	—	—
	2,00	1,29	—	2,02	—	2,26	—	2,49	—	5,20	—	6,00	—	7,30	—	7,30	—	—	—
N_{Rk} [kN]	0,50	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	
	0,55	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	
	0,63	0,61	—	0,88	—	1,07	—	1,24	—	1,60	—	1,80	ac	1,80	ac	1,80	ac	1,80	ac
	0,75	0,61	—	0,88	—	1,07	—	1,24	—	1,60	—	2,20	—	2,20	ac	2,20	ac	2,20	ac
	0,88	0,61	—	0,88	—	1,07	—	1,24	—	1,60	—	2,40	—	3,00	—	3,00	—	3,00	—
	1,00	0,61	—	0,88	—	1,07	—	1,24	—	1,60	—	2,40	—	3,90	—	3,90	—	3,90	—
	1,13	0,61	—	0,88	—	1,07	—	1,24	—	1,60	—	2,40	—	4,10	—	4,10	—	—	—
	1,25	0,61	—	0,88	—	1,07	—	1,24	—	1,60	—	2,40	—	4,10	—	4,10	—	—	—
	1,50	0,61	—	0,88	—	1,07	—	1,24	—	1,60	—	2,40	—	4,10	—	4,10	—	—	—
	1,75	0,61	—	0,88	—	1,07	—	1,24	—	1,60	—	2,40	—	4,10	—	4,10	—	—	—
	2,00	0,61	—	0,88	—	1,07	—	1,24	—	1,60	—	2,40	—	4,10	—	4,10	—	—	—
$N_{Rk,ilk}$ [kN]	0,61	—	0,88	—	1,07	—	1,24	—	1,60	—	2,40	—	4,10	—	4,10	—	4,10	—	
M_{lim} [Nm]	$\Sigma t \leq 2,15$ mm: 2 Nm					$\Sigma t > 2,15$ mm: 6 Nm													

No additional regulations.

Self drilling screw


Hilti S-MD 03 Z 4,8 x L
Hilti S-MD 03 C 4,8 x L
with hexagon head

Annex 19

Annex 11:
ETA-10/0182, Annex 20

	<p>Material:</p> <p>Fastener: carbon steel, case hardened and galvanized or coated</p> <p>Washer: carbon steel, galvanized or coated stainless Steel (1.4301) - EN 10088</p> <p>Component I: S280GD, S320GD - EN 10346</p> <p>Component II: S280GD, S320GD - EN 10346 S235 - EN 10025-1</p>																																																																																																																																																																																																																																																																																																																																												
	<p>Drilling capacity: $\Sigma t \leq 6,00$ mm</p>																																																																																																																																																																																																																																																																																																																																												
<p>Timber substructures: no performance determined</p>																																																																																																																																																																																																																																																																																																																																													
<table border="1"> <thead> <tr> <th rowspan="2">t [mm]</th> <th colspan="10">t_1 [mm]</th> </tr> <tr> <th>1,50</th><th>2,00</th><th>3,00</th><th>4,00</th><th>5,00</th><th>6,00</th><th>—</th><th>—</th><th>—</th><th>—</th> </tr> </thead> <tbody> <tr> <td rowspan="10">$V_{k,s}$ [kN]</td> <td>0,50</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td>0,55</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td>0,63</td><td>2,40</td><td>ac</td><td>2,70</td><td>ac</td><td>2,70</td><td>ac</td><td>2,70</td><td>ac</td><td>2,70</td><td>ac</td><td>—</td><td>—</td> </tr> <tr> <td>0,75</td><td>3,00</td><td>—</td><td>3,50</td><td>ac</td><td>3,90</td><td>ac</td><td>3,90</td><td>ac</td><td>3,90</td><td>ac</td><td>—</td><td>—</td> </tr> <tr> <td>0,88</td><td>3,40</td><td>—</td><td>4,10</td><td>—</td><td>5,40</td><td>—</td><td>5,40</td><td>—</td><td>5,40</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td>1,00</td><td>3,70</td><td>—</td><td>4,70</td><td>—</td><td>6,60</td><td>—</td><td>6,60</td><td>—</td><td>6,60</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td>1,13</td><td>4,00</td><td>—</td><td>5,00</td><td>—</td><td>6,70</td><td>—</td><td>6,70</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td>1,25</td><td>4,40</td><td>—</td><td>5,30</td><td>—</td><td>6,80</td><td>—</td><td>6,80</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td>1,50</td><td>4,90</td><td>—</td><td>5,60</td><td>—</td><td>6,90</td><td>—</td><td>6,90</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td>1,75</td><td>4,90</td><td>—</td><td>5,60</td><td>—</td><td>6,90</td><td>—</td><td>6,90</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td>2,00</td><td>4,90</td><td>—</td><td>5,60</td><td>—</td><td>6,90</td><td>—</td><td>6,90</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td rowspan="10">$N_{k,s}$ [kN]</td> <td>0,50</td><td>0,92</td><td>ac</td><td>1,40</td><td>ac</td><td>1,40</td><td>ac</td><td>1,40</td><td>ac</td><td>1,40</td><td>ac</td><td>—</td><td>—</td> </tr> <tr> <td>0,55</td><td>1,16</td><td>ac</td><td>1,77</td><td>ac</td><td>1,77</td><td>ac</td><td>1,77</td><td>ac</td><td>1,77</td><td>ac</td><td>—</td><td>—</td> </tr> <tr> <td>0,63</td><td>1,70</td><td>ac</td><td>2,60</td><td>ac</td><td>2,60</td><td>ac</td><td>2,60</td><td>ac</td><td>2,60</td><td>ac</td><td>—</td><td>—</td> </tr> <tr> <td>0,75</td><td>1,70</td><td>—</td><td>2,70</td><td>ac</td><td>3,30</td><td>ac</td><td>3,30</td><td>ac</td><td>3,30</td><td>ac</td><td>—</td><td>—</td> </tr> <tr> <td>0,88</td><td>1,70</td><td>—</td><td>2,70</td><td>—</td><td>4,20</td><td>—</td><td>4,20</td><td>—</td><td>4,20</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td>1,00</td><td>1,70</td><td>—</td><td>2,70</td><td>—</td><td>5,00</td><td>—</td><td>5,00</td><td>—</td><td>5,00</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td>1,13</td><td>1,70</td><td>—</td><td>2,70</td><td>—</td><td>5,20</td><td>—</td><td>5,20</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td>1,25</td><td>1,70</td><td>—</td><td>2,70</td><td>—</td><td>5,20</td><td>—</td><td>5,20</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td>1,50</td><td>1,70</td><td>—</td><td>2,70</td><td>—</td><td>5,20</td><td>—</td><td>5,20</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td>1,75</td><td>1,70</td><td>—</td><td>2,70</td><td>—</td><td>5,20</td><td>—</td><td>5,20</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td>2,00</td><td>1,70</td><td>—</td><td>2,70</td><td>—</td><td>5,20</td><td>—</td><td>5,20</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td>$M_{t,sm}$ [Nm]</td> <td colspan="6">$\Sigma t \leq 2,15$ mm: 2 Nm</td> <td colspan="6">$\Sigma t > 2,15$ mm: 6 Nm</td> </tr> </tbody> </table>												t [mm]	t_1 [mm]										1,50	2,00	3,00	4,00	5,00	6,00	—	—	—	—	$V_{k,s}$ [kN]	0,50	—	—	—	—	—	—	—	—	—	—	—	—	0,55	—	—	—	—	—	—	—	—	—	—	—	—	0,63	2,40	ac	2,70	ac	2,70	ac	2,70	ac	2,70	ac	—	—	0,75	3,00	—	3,50	ac	3,90	ac	3,90	ac	3,90	ac	—	—	0,88	3,40	—	4,10	—	5,40	—	5,40	—	5,40	—	—	—	1,00	3,70	—	4,70	—	6,60	—	6,60	—	6,60	—	—	—	1,13	4,00	—	5,00	—	6,70	—	6,70	—	—	—	—	—	1,25	4,40	—	5,30	—	6,80	—	6,80	—	—	—	—	—	1,50	4,90	—	5,60	—	6,90	—	6,90	—	—	—	—	—	1,75	4,90	—	5,60	—	6,90	—	6,90	—	—	—	—	—	2,00	4,90	—	5,60	—	6,90	—	6,90	—	—	—	—	—	$N_{k,s}$ [kN]	0,50	0,92	ac	1,40	ac	1,40	ac	1,40	ac	1,40	ac	—	—	0,55	1,16	ac	1,77	ac	1,77	ac	1,77	ac	1,77	ac	—	—	0,63	1,70	ac	2,60	ac	2,60	ac	2,60	ac	2,60	ac	—	—	0,75	1,70	—	2,70	ac	3,30	ac	3,30	ac	3,30	ac	—	—	0,88	1,70	—	2,70	—	4,20	—	4,20	—	4,20	—	—	—	1,00	1,70	—	2,70	—	5,00	—	5,00	—	5,00	—	—	—	1,13	1,70	—	2,70	—	5,20	—	5,20	—	—	—	—	—	1,25	1,70	—	2,70	—	5,20	—	5,20	—	—	—	—	—	1,50	1,70	—	2,70	—	5,20	—	5,20	—	—	—	—	—	1,75	1,70	—	2,70	—	5,20	—	5,20	—	—	—	—	—	2,00	1,70	—	2,70	—	5,20	—	5,20	—	—	—	—	—	$M_{t,sm}$ [Nm]	$\Sigma t \leq 2,15$ mm: 2 Nm						$\Sigma t > 2,15$ mm: 6 Nm					
t [mm]	t_1 [mm]																																																																																																																																																																																																																																																																																																																																												
	1,50	2,00	3,00	4,00	5,00	6,00	—	—	—	—																																																																																																																																																																																																																																																																																																																																			
$V_{k,s}$ [kN]	0,50	—	—	—	—	—	—	—	—	—	—	—	—																																																																																																																																																																																																																																																																																																																																
	0,55	—	—	—	—	—	—	—	—	—	—	—	—																																																																																																																																																																																																																																																																																																																																
	0,63	2,40	ac	2,70	ac	2,70	ac	2,70	ac	2,70	ac	—	—																																																																																																																																																																																																																																																																																																																																
	0,75	3,00	—	3,50	ac	3,90	ac	3,90	ac	3,90	ac	—	—																																																																																																																																																																																																																																																																																																																																
	0,88	3,40	—	4,10	—	5,40	—	5,40	—	5,40	—	—	—																																																																																																																																																																																																																																																																																																																																
	1,00	3,70	—	4,70	—	6,60	—	6,60	—	6,60	—	—	—																																																																																																																																																																																																																																																																																																																																
	1,13	4,00	—	5,00	—	6,70	—	6,70	—	—	—	—	—																																																																																																																																																																																																																																																																																																																																
	1,25	4,40	—	5,30	—	6,80	—	6,80	—	—	—	—	—																																																																																																																																																																																																																																																																																																																																
	1,50	4,90	—	5,60	—	6,90	—	6,90	—	—	—	—	—																																																																																																																																																																																																																																																																																																																																
	1,75	4,90	—	5,60	—	6,90	—	6,90	—	—	—	—	—																																																																																																																																																																																																																																																																																																																																
2,00	4,90	—	5,60	—	6,90	—	6,90	—	—	—	—	—																																																																																																																																																																																																																																																																																																																																	
$N_{k,s}$ [kN]	0,50	0,92	ac	1,40	ac	1,40	ac	1,40	ac	1,40	ac	—	—																																																																																																																																																																																																																																																																																																																																
	0,55	1,16	ac	1,77	ac	1,77	ac	1,77	ac	1,77	ac	—	—																																																																																																																																																																																																																																																																																																																																
	0,63	1,70	ac	2,60	ac	2,60	ac	2,60	ac	2,60	ac	—	—																																																																																																																																																																																																																																																																																																																																
	0,75	1,70	—	2,70	ac	3,30	ac	3,30	ac	3,30	ac	—	—																																																																																																																																																																																																																																																																																																																																
	0,88	1,70	—	2,70	—	4,20	—	4,20	—	4,20	—	—	—																																																																																																																																																																																																																																																																																																																																
	1,00	1,70	—	2,70	—	5,00	—	5,00	—	5,00	—	—	—																																																																																																																																																																																																																																																																																																																																
	1,13	1,70	—	2,70	—	5,20	—	5,20	—	—	—	—	—																																																																																																																																																																																																																																																																																																																																
	1,25	1,70	—	2,70	—	5,20	—	5,20	—	—	—	—	—																																																																																																																																																																																																																																																																																																																																
	1,50	1,70	—	2,70	—	5,20	—	5,20	—	—	—	—	—																																																																																																																																																																																																																																																																																																																																
	1,75	1,70	—	2,70	—	5,20	—	5,20	—	—	—	—	—																																																																																																																																																																																																																																																																																																																																
2,00	1,70	—	2,70	—	5,20	—	5,20	—	—	—	—	—																																																																																																																																																																																																																																																																																																																																	
$M_{t,sm}$ [Nm]	$\Sigma t \leq 2,15$ mm: 2 Nm						$\Sigma t > 2,15$ mm: 6 Nm																																																																																																																																																																																																																																																																																																																																						
No additional regulations.																																																																																																																																																																																																																																																																																																																																													
Self drilling screw										Annex 20																																																																																																																																																																																																																																																																																																																																			
Hilti S-MD 53 Z 4,8 x L Hilti S-MD 53 C 4,8 x L with hexagon head and sealing washer $\geq \phi 16$ mm																																																																																																																																																																																																																																																																																																																																													

Annex 12:
ETA-10/0182, Annex 21

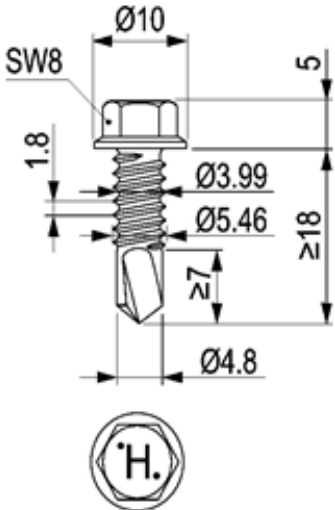

Material:
Fastener: carbon steel, case hardened and galvanized or coated
Washer: none
Component I: S280GD, S320GD, S350GD, S390GD - EN 10346
Component II: S280GD, S320GD, S350GD, S390GD - EN 10346
S235, S275, S355 - EN 10025-1

Drilling capacity: $\Sigma t_i \leq 6,00$ mm

Timber substructures:
no performance determined

t_i [mm]	t_i [mm]									
	0,63	0,75	0,88	1,00	1,50	2,00	3,00	4,00	5,00	
V_{tix} [kN]	0,50	—	—	—	—	—	—	—	—	—
	0,55	—	—	—	—	—	—	—	—	—
	0,63	1,81	1,81	1,81	1,88	1,88	2,80 ac	2,80 ac	2,80 ac	2,80 ac
	0,75	1,81	1,88	1,88	2,08	2,08	3,70 ac	3,70 ac	3,70 ac	3,70 ac
	0,88	1,81	1,88	2,05	2,13	2,13	4,50	5,00 ac	5,00 ac	5,00 ac
	1,00	1,81	1,88	2,05	2,20	2,20	4,50	6,50 ac	6,50 ac	6,50 a
	1,13	1,81	1,88	2,05	2,20	2,76	4,90	7,00	7,90	—
	1,25	1,81	1,88	2,05	2,20	3,28	5,30	7,40	9,30	—
	1,50	1,81	1,88	2,05	2,20	4,36	6,20	8,30	9,50	—
	1,75	1,81	1,88	2,05	2,20	4,36	6,20	8,30	9,50	—
	2,00	1,81	1,88	2,05	2,20	4,36	7,80	9,40	9,50	—
N_{tix} [kN]	0,50	—	—	—	—	—	—	—	—	—
	0,55	—	—	—	—	—	—	—	—	—
	0,63	0,81	0,80	1,02	1,23	1,70	1,70 ac	1,70 ac	1,70 ac	1,70 ac
	0,75	0,81	0,80	1,02	1,23	2,15	2,20 ac	2,20 ac	2,20 ac	2,20 ac
	0,88	0,81	0,80	1,02	1,23	2,15	2,90	2,90 ac	2,90 ac	2,90 ac
	1,00	0,81	0,80	1,02	1,23	2,15	3,16	3,50	3,50 ac	3,50 a
	1,13	0,81	0,80	1,02	1,23	2,15	3,16	4,30	4,30	—
	1,25	0,81	0,80	1,02	1,23	2,15	3,16	5,10	5,10	—
	1,50	0,81	0,80	1,02	1,23	2,15	3,16	5,48	6,90	—
	1,75	0,81	0,80	1,02	1,23	2,15	3,16	5,48	8,20	—
	2,00	0,81	0,80	1,02	1,23	2,15	3,16	5,48	8,20	—
$N_{t,ilk}$ [kN]	0,81	0,80	1,02	1,23	2,15	3,16	5,48	8,20	8,20	
$M_{t,ilk}$ [Nm]	$\Sigma t_i \leq 3,00$ mm: 7 Nm					$\Sigma t_i > 3,00$ mm: 8 Nm				

No additional regulations.

Self drilling screw

Hilti S-MD 03 Z 5,5 x L
Hilti S-MD 03 C 5,5 x L
with hexagon head

Annex 21

Annex 13:
ETA-10/0182, Annex 22

	<p>Material: Fastener: carbon steel, case hardened and galvanized or coated Washer: none Component I: S280GD, S320GD, S350GD, S390GD - EN 10346 Component II: S280GD, S320GD, S350GD, S390GD - EN 10346 S235, S275, S355 - EN 10025-1</p>																																																																																																																																																																																																																																																																																
	<p>Drilling capacity: $\Sigma t \leq 6,00$ mm</p>																																																																																																																																																																																																																																																																																
<p>Timber substructures: no performance determined</p>																																																																																																																																																																																																																																																																																	
<table border="1"> <thead> <tr> <th rowspan="2">t_1 [mm]</th> <th colspan="10">t_2 [mm]</th> </tr> <tr> <th>0,63</th> <th>0,75</th> <th>0,88</th> <th>1,00</th> <th>1,50</th> <th>2,00</th> <th>3,00</th> <th>4,00</th> <th>5,00</th> </tr> </thead> <tbody> <tr> <td rowspan="12">$V_{0,2}$ [kN]</td> <td>0,50</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td>0,55</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td>0,63</td><td>1,81</td><td>1,81</td><td>1,81</td><td>1,88</td><td>1,88</td><td>2,80 ac</td><td>2,80 ac</td><td>2,80 ac</td><td>2,80 ac</td> </tr> <tr> <td>0,75</td><td>1,81</td><td>1,88</td><td>1,88</td><td>2,06</td><td>2,06</td><td>3,70 ac</td><td>3,70 ac</td><td>3,70 ac</td><td>3,70 ac</td> </tr> <tr> <td>0,88</td><td>1,81</td><td>1,88</td><td>2,05</td><td>2,13</td><td>2,13</td><td>4,50</td><td>5,00 ac</td><td>5,00 ac</td><td>5,00 ac</td> </tr> <tr> <td>1,00</td><td>1,81</td><td>1,88</td><td>2,05</td><td>2,20</td><td>2,20</td><td>4,50</td><td>6,50 a</td><td>6,50 a</td><td>6,50 a</td> </tr> <tr> <td>1,13</td><td>1,81</td><td>1,88</td><td>2,05</td><td>2,20</td><td>2,78</td><td>4,90</td><td>7,00</td><td>7,90</td><td>—</td> </tr> <tr> <td>1,25</td><td>1,81</td><td>1,88</td><td>2,05</td><td>2,20</td><td>3,28</td><td>5,30</td><td>7,40</td><td>9,30</td><td>—</td> </tr> <tr> <td>1,50</td><td>1,81</td><td>1,88</td><td>2,05</td><td>2,20</td><td>4,38</td><td>6,20</td><td>8,30</td><td>9,50</td><td>—</td> </tr> <tr> <td>1,75</td><td>1,81</td><td>1,88</td><td>2,05</td><td>2,20</td><td>4,38</td><td>6,20</td><td>8,30</td><td>9,50</td><td>—</td> </tr> <tr> <td>2,00</td><td>1,81</td><td>1,88</td><td>2,05</td><td>2,20</td><td>4,38</td><td>7,80</td><td>9,40</td><td>9,50</td><td>—</td> </tr> <tr> <td rowspan="12">$N_{0,2}$ [kN]</td> <td>0,50</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td>0,55</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td>0,63</td><td>0,81</td><td>0,80</td><td>1,02 ac</td><td>1,23</td><td>2,15</td><td>3,11 ac</td><td>3,11 ac</td><td>3,11 ac</td><td>3,11 ac</td> </tr> <tr> <td>0,75</td><td>0,81</td><td>0,80</td><td>1,02 ac</td><td>1,23</td><td>2,15</td><td>3,16 ac</td><td>4,61 ac</td><td>4,61 ac</td><td>4,61 ac</td> </tr> <tr> <td>0,88</td><td>0,81</td><td>0,80</td><td>1,02</td><td>1,23</td><td>2,15</td><td>3,16</td><td>5,48 ac</td><td>6,25 ac</td><td>6,25 ac</td> </tr> <tr> <td>1,00</td><td>0,81</td><td>0,80</td><td>1,02</td><td>1,23</td><td>2,15</td><td>3,16</td><td>5,48 a</td><td>7,75 a</td><td>7,75 a</td> </tr> <tr> <td>1,13</td><td>0,81</td><td>0,80</td><td>1,02</td><td>1,23</td><td>2,15</td><td>3,16</td><td>5,48</td><td>8,20</td><td>—</td> </tr> <tr> <td>1,25</td><td>0,81</td><td>0,80</td><td>1,02</td><td>1,23</td><td>2,15</td><td>3,16</td><td>5,48</td><td>8,20</td><td>—</td> </tr> <tr> <td>1,50</td><td>0,81</td><td>0,80</td><td>1,02</td><td>1,23</td><td>2,15</td><td>3,16</td><td>5,48</td><td>8,20</td><td>—</td> </tr> <tr> <td>1,75</td><td>0,81</td><td>0,80</td><td>1,02</td><td>1,23</td><td>2,15</td><td>3,16</td><td>5,48</td><td>8,20</td><td>—</td> </tr> <tr> <td>2,00</td><td>0,81</td><td>0,80</td><td>1,02</td><td>1,23</td><td>2,15</td><td>3,16</td><td>5,48</td><td>8,20</td><td>—</td> </tr> <tr> <td>$N_{R,ilk}$ [kN]</td> <td>0,61</td> <td>0,80</td> <td>1,02</td> <td>1,23</td> <td>2,15</td> <td>3,16</td> <td>5,48</td> <td>8,20</td> <td>8,20</td> </tr> <tr> <td>$M_{t,0,2}$ [Nm]</td> <td colspan="5">$\Sigma t \leq 3,00$ mm: 7 Nm</td> <td colspan="5">$\Sigma t > 3,00$ mm: 8 Nm</td> </tr> </tbody> </table>											t_1 [mm]	t_2 [mm]										0,63	0,75	0,88	1,00	1,50	2,00	3,00	4,00	5,00	$V_{0,2}$ [kN]	0,50	—	—	—	—	—	—	—	—	—	0,55	—	—	—	—	—	—	—	—	—	0,63	1,81	1,81	1,81	1,88	1,88	2,80 ac	2,80 ac	2,80 ac	2,80 ac	0,75	1,81	1,88	1,88	2,06	2,06	3,70 ac	3,70 ac	3,70 ac	3,70 ac	0,88	1,81	1,88	2,05	2,13	2,13	4,50	5,00 ac	5,00 ac	5,00 ac	1,00	1,81	1,88	2,05	2,20	2,20	4,50	6,50 a	6,50 a	6,50 a	1,13	1,81	1,88	2,05	2,20	2,78	4,90	7,00	7,90	—	1,25	1,81	1,88	2,05	2,20	3,28	5,30	7,40	9,30	—	1,50	1,81	1,88	2,05	2,20	4,38	6,20	8,30	9,50	—	1,75	1,81	1,88	2,05	2,20	4,38	6,20	8,30	9,50	—	2,00	1,81	1,88	2,05	2,20	4,38	7,80	9,40	9,50	—	$N_{0,2}$ [kN]	0,50	—	—	—	—	—	—	—	—	—	0,55	—	—	—	—	—	—	—	—	—	0,63	0,81	0,80	1,02 ac	1,23	2,15	3,11 ac	3,11 ac	3,11 ac	3,11 ac	0,75	0,81	0,80	1,02 ac	1,23	2,15	3,16 ac	4,61 ac	4,61 ac	4,61 ac	0,88	0,81	0,80	1,02	1,23	2,15	3,16	5,48 ac	6,25 ac	6,25 ac	1,00	0,81	0,80	1,02	1,23	2,15	3,16	5,48 a	7,75 a	7,75 a	1,13	0,81	0,80	1,02	1,23	2,15	3,16	5,48	8,20	—	1,25	0,81	0,80	1,02	1,23	2,15	3,16	5,48	8,20	—	1,50	0,81	0,80	1,02	1,23	2,15	3,16	5,48	8,20	—	1,75	0,81	0,80	1,02	1,23	2,15	3,16	5,48	8,20	—	2,00	0,81	0,80	1,02	1,23	2,15	3,16	5,48	8,20	—	$N_{R,ilk}$ [kN]	0,61	0,80	1,02	1,23	2,15	3,16	5,48	8,20	8,20	$M_{t,0,2}$ [Nm]	$\Sigma t \leq 3,00$ mm: 7 Nm					$\Sigma t > 3,00$ mm: 8 Nm				
t_1 [mm]	t_2 [mm]																																																																																																																																																																																																																																																																																
	0,63	0,75	0,88	1,00	1,50	2,00	3,00	4,00	5,00																																																																																																																																																																																																																																																																								
$V_{0,2}$ [kN]	0,50	—	—	—	—	—	—	—	—	—																																																																																																																																																																																																																																																																							
	0,55	—	—	—	—	—	—	—	—	—																																																																																																																																																																																																																																																																							
	0,63	1,81	1,81	1,81	1,88	1,88	2,80 ac	2,80 ac	2,80 ac	2,80 ac																																																																																																																																																																																																																																																																							
	0,75	1,81	1,88	1,88	2,06	2,06	3,70 ac	3,70 ac	3,70 ac	3,70 ac																																																																																																																																																																																																																																																																							
	0,88	1,81	1,88	2,05	2,13	2,13	4,50	5,00 ac	5,00 ac	5,00 ac																																																																																																																																																																																																																																																																							
	1,00	1,81	1,88	2,05	2,20	2,20	4,50	6,50 a	6,50 a	6,50 a																																																																																																																																																																																																																																																																							
	1,13	1,81	1,88	2,05	2,20	2,78	4,90	7,00	7,90	—																																																																																																																																																																																																																																																																							
	1,25	1,81	1,88	2,05	2,20	3,28	5,30	7,40	9,30	—																																																																																																																																																																																																																																																																							
	1,50	1,81	1,88	2,05	2,20	4,38	6,20	8,30	9,50	—																																																																																																																																																																																																																																																																							
	1,75	1,81	1,88	2,05	2,20	4,38	6,20	8,30	9,50	—																																																																																																																																																																																																																																																																							
	2,00	1,81	1,88	2,05	2,20	4,38	7,80	9,40	9,50	—																																																																																																																																																																																																																																																																							
	$N_{0,2}$ [kN]	0,50	—	—	—	—	—	—	—	—	—																																																																																																																																																																																																																																																																						
0,55		—	—	—	—	—	—	—	—	—																																																																																																																																																																																																																																																																							
0,63		0,81	0,80	1,02 ac	1,23	2,15	3,11 ac	3,11 ac	3,11 ac	3,11 ac																																																																																																																																																																																																																																																																							
0,75		0,81	0,80	1,02 ac	1,23	2,15	3,16 ac	4,61 ac	4,61 ac	4,61 ac																																																																																																																																																																																																																																																																							
0,88		0,81	0,80	1,02	1,23	2,15	3,16	5,48 ac	6,25 ac	6,25 ac																																																																																																																																																																																																																																																																							
1,00		0,81	0,80	1,02	1,23	2,15	3,16	5,48 a	7,75 a	7,75 a																																																																																																																																																																																																																																																																							
1,13		0,81	0,80	1,02	1,23	2,15	3,16	5,48	8,20	—																																																																																																																																																																																																																																																																							
1,25		0,81	0,80	1,02	1,23	2,15	3,16	5,48	8,20	—																																																																																																																																																																																																																																																																							
1,50		0,81	0,80	1,02	1,23	2,15	3,16	5,48	8,20	—																																																																																																																																																																																																																																																																							
1,75		0,81	0,80	1,02	1,23	2,15	3,16	5,48	8,20	—																																																																																																																																																																																																																																																																							
2,00		0,81	0,80	1,02	1,23	2,15	3,16	5,48	8,20	—																																																																																																																																																																																																																																																																							
$N_{R,ilk}$ [kN]		0,61	0,80	1,02	1,23	2,15	3,16	5,48	8,20	8,20																																																																																																																																																																																																																																																																							
$M_{t,0,2}$ [Nm]	$\Sigma t \leq 3,00$ mm: 7 Nm					$\Sigma t > 3,00$ mm: 8 Nm																																																																																																																																																																																																																																																																											
<p>No additional regulations.</p>																																																																																																																																																																																																																																																																																	
<p>Self drilling screw</p>										<p>Annex 22</p>																																																																																																																																																																																																																																																																							
<p>Hilti S-MD 23 Z 5,5 x L Hilti S-MD 23 C 5,5 x L with hexagon head with collar</p>																																																																																																																																																																																																																																																																																	

Annex 14:
ETA-10/0182, Annex 23

Material:

Fastener: carbon steel, case hardened and galvanized or coated

Washer: carbon steel, galvanized or coated
stainless Steel (1.4301) - EN 10088

Component I: S280GD, S320GD, S350GD, S390GD - EN 10346

Component II: S280GD, S320GD, S350GD, S390GD - EN 10346
S235, S275, S355 - EN 10025-1

Drilling capacity: $\Sigma t_i \leq 6,00$ mm

Timber substructures:
no performance determined

t _i [mm]	t _i [mm]																
	0,63	0,75	0,88	1,00	1,50	2,00	3,00	4,00									
V _{0,2k} [kN]	0,50	—	—	—	—	—	—	—	—								
	0,55	—	—	—	—	—	—	—	—								
	0,63	—	—	—	—	—	3,10	ac	3,10	abcd							
	0,75	—	—	—	—	—	3,80	ac	3,80	ac							
	0,88	—	—	—	—	—	4,80	—	4,80	ac							
	1,00	—	—	—	—	—	5,30	—	5,40	a							
	1,13	—	—	—	—	—	5,30	—	6,20	—							
	1,25	—	—	—	—	—	5,30	—	7,60	—							
	1,50	—	—	—	—	—	6,10	—	9,10	—							
	1,75	—	—	—	—	—	6,10	—	9,10	—							
2,00	—	—	—	—	—	7,80	—	9,70	—								
N _{0,2k} [kN]	0,50	0,61	—	0,80	—	1,02	—	1,23	—	1,73	—	1,73	ac	1,73	ac	1,73	abcd
	0,55	0,61	—	0,80	—	1,02	—	1,23	—	2,15	—	2,18	ac	2,18	ac	2,18	abcd
	0,63	0,61	—	0,80	—	1,02	—	1,23	—	2,15	—	3,16	ac	3,20	ac	3,20	abcd
	0,75	0,61	—	0,80	—	1,02	—	1,23	—	2,15	—	3,16	ac	3,90	ac	3,90	ac
	0,88	0,61	—	0,80	—	1,02	—	1,23	—	2,15	—	3,16	—	4,80	ac	4,80	ac
	1,00	0,61	—	0,80	—	1,02	—	1,23	—	2,15	—	3,16	—	5,48	—	5,60	a
	1,13	0,61	—	0,80	—	1,02	—	1,23	—	2,15	—	3,16	—	5,48	—	6,50	—
	1,25	0,61	—	0,80	—	1,02	—	1,23	—	2,15	—	3,16	—	5,48	—	7,20	—
	1,50	0,61	—	0,80	—	1,02	—	1,23	—	2,15	—	3,16	—	5,48	—	8,20	—
	1,75	0,61	—	0,80	—	1,02	—	1,23	—	2,15	—	3,16	—	5,48	—	8,20	—
2,00	0,61	—	0,80	—	1,02	—	1,23	—	2,15	—	3,16	—	5,48	—	8,20	—	
N _{0,1k} [kN]	0,61	—	0,80	—	1,02	—	1,23	—	2,15	—	3,16	—	5,48	—	8,20	—	
M _{0,1k} [Nm]	Σt _i ≤ 3,00 mm: 7 Nm								Σt _i > 3,00 mm: 8 Nm								

No additional regulations.

Self drilling screw

Hilti S-MD 53 Z 5,5 x L
Hilti S-MD 53 C 5,5 x L
with hexagon head and sealing washer ≥ Ø16 mm

Annex 23

Annex 15:
ETA-10/0182, Annex 24

	<p>Material:</p> <p>Fastener: carbon steel, case hardened and galvanized or coated</p> <p>Washer: none</p> <p>Component I: S280GD, S320GD, S350GD, S390GD - EN 10346</p> <p>Component II: S280GD, S320GD, S350GD, S390GD - EN 10346 S235, S275, S355 - EN 10025-1</p>
	<p>Drilling capacity: $\Sigma t \leq 6,00$ mm</p>
<p>Timber substructures: no performance determined</p>	

t [mm]	t ₁ [mm]								
	1,00	1,50	2,00	2,50	3,00	4,00	5,00	6,00	
V _{0,3} [kN]	0,50	—	—	—	—	—	—	—	—
	0,55	—	—	—	—	—	—	—	—
	0,63	1,92	1,92	3,10	3,10	3,10	3,10	3,10	3,10
	0,75	2,07	2,07	4,20	4,20	4,20	4,20	4,20	4,20
	0,88	2,35	2,35	5,40	5,40	5,40	5,40	5,40	5,40
	1,00	2,60	2,60	5,60	5,60	6,60	6,60	6,60	6,60
	1,13	2,60	3,16	5,70	5,70	7,80	8,00	—	—
	1,25	2,60	3,68	5,90	5,90	9,00	9,56	—	—
	1,50	2,60	4,75	7,00	7,00	9,70	10,00	—	—
	1,75	2,60	4,75	7,00	7,00	9,70	10,00	—	—
	2,00	2,60	4,75	7,00	7,00	9,70	10,00	—	—
N _{0,3} [kN]	0,50	—	—	—	—	—	—	—	—
	0,55	—	—	—	—	—	—	—	—
	0,63	1,23	1,90	1,90	1,90	1,90	1,90	1,90	1,90
	0,75	1,23	2,46	2,80	2,80	2,80	2,80	2,80	2,80
	0,88	1,23	2,46	3,21	3,40	3,40	3,40	3,40	3,40
	1,00	1,23	2,46	3,21	4,30	4,30	4,30	4,30	4,30
	1,13	1,23	2,46	3,21	4,62	5,30	5,30	—	—
	1,25	1,23	2,46	3,21	4,62	6,03	6,40	—	—
	1,50	1,23	2,46	3,21	4,62	6,03	6,90	—	—
	1,75	1,23	2,46	3,21	4,62	6,03	6,90	—	—
	2,00	1,23	2,46	3,21	4,62	6,03	7,20	—	—
M _{nom} [Nm]	$\Sigma t \leq 3,00$ mm: 7 Nm				$\Sigma t > 3,00$ mm: 8 Nm				

No additional regulations.

Self drilling screw

Hilti S-MD 03 Z 6,3 x L
Hilti S-MD 03 C 6,3 x L
with hexagon head

Annex 24


Annex 16:
ETA-10/0182, Annex 25

	<p>Material:</p> <p>Fastener: carbon steel, case hardened and galvanized or coated</p> <p>Washer: none</p> <p>Component I: S280GD, S320GD, S350GD, S390GD - EN 10346</p> <p>Component II: S280GD, S320GD, S350GD, S390GD - EN 10346 S235, S275, S355 - EN 10025-1</p>																																																																																																																																																																																																																																									
	<p>Drilling capacity: $\Sigma t_i \leq 6,00$ mm</p>																																																																																																																																																																																																																																									
<p>Timber substructures: no performance determined</p>																																																																																																																																																																																																																																										
<table border="1"> <thead> <tr> <th rowspan="2">t_i [mm]</th> <th colspan="8">t_i [mm]</th> </tr> <tr> <th>1,00</th> <th>1,50</th> <th>2,00</th> <th>2,50</th> <th>3,00</th> <th>4,00</th> <th>5,00</th> <th>6,00</th> </tr> </thead> <tbody> <tr> <td rowspan="10">$V_{i,k}$ [kN]</td> <td>0,50</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td>0,55</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td>0,63</td><td>1,92</td><td>1,92</td><td>3,10</td><td>3,10</td><td>3,10</td><td>3,10</td><td>3,10</td><td>3,10</td> </tr> <tr> <td>0,75</td><td>2,07</td><td>2,07</td><td>4,20</td><td>4,20</td><td>4,20</td><td>4,20</td><td>4,20</td><td>4,20</td> </tr> <tr> <td>0,88</td><td>2,35</td><td>2,35</td><td>5,40</td><td>5,40</td><td>5,40</td><td>5,40</td><td>5,40</td><td>5,40</td> </tr> <tr> <td>1,00</td><td>2,80</td><td>2,80</td><td>5,60</td><td>5,60</td><td>6,60</td><td>6,60</td><td>6,60</td><td>6,60</td> </tr> <tr> <td>1,13</td><td>2,80</td><td>3,16</td><td>5,70</td><td>5,70</td><td>7,80</td><td>8,00</td><td>—</td><td>—</td> </tr> <tr> <td>1,25</td><td>2,80</td><td>3,68</td><td>5,90</td><td>5,90</td><td>9,00</td><td>9,56</td><td>—</td><td>—</td> </tr> <tr> <td>1,50</td><td>2,80</td><td>4,75</td><td>7,00</td><td>7,00</td><td>9,70</td><td>10,00</td><td>—</td><td>—</td> </tr> <tr> <td>1,75</td><td>2,80</td><td>4,75</td><td>7,00</td><td>7,00</td><td>9,70</td><td>10,00</td><td>—</td><td>—</td> </tr> <tr> <td>2,00</td><td>2,80</td><td>4,75</td><td>7,00</td><td>7,00</td><td>9,70</td><td>10,00</td><td>—</td><td>—</td> </tr> <tr> <td rowspan="10">$N_{i,k}$ [kN]</td> <td>0,50</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td>0,55</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td>0,63</td><td>1,23</td><td>2,01</td><td>2,01</td><td>2,01</td><td>2,01</td><td>2,01</td><td>2,01</td><td>2,01</td> </tr> <tr> <td>0,75</td><td>1,23</td><td>2,29</td><td>2,29</td><td>2,29</td><td>2,29</td><td>2,29</td><td>2,29</td><td>2,29</td> </tr> <tr> <td>0,88</td><td>1,23</td><td>2,46</td><td>2,92</td><td>2,92</td><td>2,92</td><td>2,92</td><td>2,92</td><td>2,92</td> </tr> <tr> <td>1,00</td><td>1,23</td><td>2,46</td><td>3,21</td><td>3,78</td><td>3,78</td><td>3,78</td><td>3,78</td><td>3,78</td> </tr> <tr> <td>1,13</td><td>1,23</td><td>2,46</td><td>3,21</td><td>4,62</td><td>5,04</td><td>5,04</td><td>—</td><td>—</td> </tr> <tr> <td>1,25</td><td>1,23</td><td>2,46</td><td>3,21</td><td>4,62</td><td>6,03</td><td>6,49</td><td>—</td><td>—</td> </tr> <tr> <td>1,50</td><td>1,23</td><td>2,46</td><td>3,21</td><td>4,62</td><td>6,03</td><td>6,90</td><td>—</td><td>—</td> </tr> <tr> <td>1,75</td><td>1,23</td><td>2,46</td><td>3,21</td><td>4,62</td><td>6,03</td><td>7,20</td><td>—</td><td>—</td> </tr> <tr> <td>2,00</td><td>1,23</td><td>2,46</td><td>3,21</td><td>4,62</td><td>6,03</td><td>7,20</td><td>—</td><td>—</td> </tr> <tr> <td>$M_{t,perm}$ [Nm]</td> <td colspan="4">$\Sigma t_i \leq 3,00$ mm: 7 Nm</td> <td colspan="4">$\Sigma t_i > 3,00$ mm: 8 Nm</td> </tr> </tbody> </table>									t_i [mm]	t_i [mm]								1,00	1,50	2,00	2,50	3,00	4,00	5,00	6,00	$V_{i,k}$ [kN]	0,50	—	—	—	—	—	—	—	—	0,55	—	—	—	—	—	—	—	—	0,63	1,92	1,92	3,10	3,10	3,10	3,10	3,10	3,10	0,75	2,07	2,07	4,20	4,20	4,20	4,20	4,20	4,20	0,88	2,35	2,35	5,40	5,40	5,40	5,40	5,40	5,40	1,00	2,80	2,80	5,60	5,60	6,60	6,60	6,60	6,60	1,13	2,80	3,16	5,70	5,70	7,80	8,00	—	—	1,25	2,80	3,68	5,90	5,90	9,00	9,56	—	—	1,50	2,80	4,75	7,00	7,00	9,70	10,00	—	—	1,75	2,80	4,75	7,00	7,00	9,70	10,00	—	—	2,00	2,80	4,75	7,00	7,00	9,70	10,00	—	—	$N_{i,k}$ [kN]	0,50	—	—	—	—	—	—	—	—	0,55	—	—	—	—	—	—	—	—	0,63	1,23	2,01	2,01	2,01	2,01	2,01	2,01	2,01	0,75	1,23	2,29	2,29	2,29	2,29	2,29	2,29	2,29	0,88	1,23	2,46	2,92	2,92	2,92	2,92	2,92	2,92	1,00	1,23	2,46	3,21	3,78	3,78	3,78	3,78	3,78	1,13	1,23	2,46	3,21	4,62	5,04	5,04	—	—	1,25	1,23	2,46	3,21	4,62	6,03	6,49	—	—	1,50	1,23	2,46	3,21	4,62	6,03	6,90	—	—	1,75	1,23	2,46	3,21	4,62	6,03	7,20	—	—	2,00	1,23	2,46	3,21	4,62	6,03	7,20	—	—	$M_{t,perm}$ [Nm]	$\Sigma t_i \leq 3,00$ mm: 7 Nm				$\Sigma t_i > 3,00$ mm: 8 Nm			
t_i [mm]	t_i [mm]																																																																																																																																																																																																																																									
	1,00	1,50	2,00	2,50	3,00	4,00	5,00	6,00																																																																																																																																																																																																																																		
$V_{i,k}$ [kN]	0,50	—	—	—	—	—	—	—	—																																																																																																																																																																																																																																	
	0,55	—	—	—	—	—	—	—	—																																																																																																																																																																																																																																	
	0,63	1,92	1,92	3,10	3,10	3,10	3,10	3,10	3,10																																																																																																																																																																																																																																	
	0,75	2,07	2,07	4,20	4,20	4,20	4,20	4,20	4,20																																																																																																																																																																																																																																	
	0,88	2,35	2,35	5,40	5,40	5,40	5,40	5,40	5,40																																																																																																																																																																																																																																	
	1,00	2,80	2,80	5,60	5,60	6,60	6,60	6,60	6,60																																																																																																																																																																																																																																	
	1,13	2,80	3,16	5,70	5,70	7,80	8,00	—	—																																																																																																																																																																																																																																	
	1,25	2,80	3,68	5,90	5,90	9,00	9,56	—	—																																																																																																																																																																																																																																	
	1,50	2,80	4,75	7,00	7,00	9,70	10,00	—	—																																																																																																																																																																																																																																	
	1,75	2,80	4,75	7,00	7,00	9,70	10,00	—	—																																																																																																																																																																																																																																	
2,00	2,80	4,75	7,00	7,00	9,70	10,00	—	—																																																																																																																																																																																																																																		
$N_{i,k}$ [kN]	0,50	—	—	—	—	—	—	—	—																																																																																																																																																																																																																																	
	0,55	—	—	—	—	—	—	—	—																																																																																																																																																																																																																																	
	0,63	1,23	2,01	2,01	2,01	2,01	2,01	2,01	2,01																																																																																																																																																																																																																																	
	0,75	1,23	2,29	2,29	2,29	2,29	2,29	2,29	2,29																																																																																																																																																																																																																																	
	0,88	1,23	2,46	2,92	2,92	2,92	2,92	2,92	2,92																																																																																																																																																																																																																																	
	1,00	1,23	2,46	3,21	3,78	3,78	3,78	3,78	3,78																																																																																																																																																																																																																																	
	1,13	1,23	2,46	3,21	4,62	5,04	5,04	—	—																																																																																																																																																																																																																																	
	1,25	1,23	2,46	3,21	4,62	6,03	6,49	—	—																																																																																																																																																																																																																																	
	1,50	1,23	2,46	3,21	4,62	6,03	6,90	—	—																																																																																																																																																																																																																																	
	1,75	1,23	2,46	3,21	4,62	6,03	7,20	—	—																																																																																																																																																																																																																																	
2,00	1,23	2,46	3,21	4,62	6,03	7,20	—	—																																																																																																																																																																																																																																		
$M_{t,perm}$ [Nm]	$\Sigma t_i \leq 3,00$ mm: 7 Nm				$\Sigma t_i > 3,00$ mm: 8 Nm																																																																																																																																																																																																																																					
<p>No additional regulations.</p>																																																																																																																																																																																																																																										
<p>Self drilling screw</p>							<p>Annex 25</p>																																																																																																																																																																																																																																			
<p>Hilti S-MD 23 Z 6,3 x L Hilti S-MD 23 C 6,3 x L with hexagon head with collar</p>																																																																																																																																																																																																																																										

Annex 17:
ETA-10/0182, Annex 26

	<p>Material:</p> <p>Fastener: carbon steel, case hardened and galvanized or coated</p> <p>Washer: carbon steel, galvanized or coated stainless Steel (1.4301) - EN 10088</p> <p>Component I: S280GD, S320GD, S350GD, S390GD - EN 10346</p> <p>Component II: S280GD, S320GD, S350GD, S390GD - EN 10346 S235, S275, S355 - EN 10025-1</p>																																																																																																																																																																																																																																																																					
	<p>Drilling capacity: $\Sigma t_i \leq 6,00$ mm</p>																																																																																																																																																																																																																																																																					
<p>Timber substructures: no performance determined</p>																																																																																																																																																																																																																																																																						
<table border="1"> <thead> <tr> <th>t_i [mm]</th> <th colspan="8">t_i [mm]</th> </tr> <tr> <th></th> <th>1,50</th> <th>2,00</th> <th>2,50</th> <th>3,00</th> <th>4,00</th> <th>5,00</th> <th>6,00</th> <th>—</th> <th>—</th> </tr> </thead> <tbody> <tr> <td rowspan="11">$N_{t,k}$ [kN]</td> <td>0,50</td> <td>—</td> <td>—</td> <td>—</td> <td>—</td> <td>—</td> <td>—</td> <td>—</td> <td>—</td> <td>—</td> </tr> <tr> <td>0,55</td> <td>—</td> <td>—</td> <td>—</td> <td>—</td> <td>—</td> <td>—</td> <td>—</td> <td>—</td> <td>—</td> </tr> <tr> <td>0,63</td> <td>—</td> <td>3,00 ac</td> <td>3,00 ac</td> <td>3,00 abcd</td> <td>3,00 abcd</td> <td>3,00 abcd</td> <td>—</td> <td>—</td> <td>—</td> </tr> <tr> <td>0,75</td> <td>—</td> <td>3,80 ac</td> <td>3,80 ac</td> <td>3,80 abcd</td> <td>3,80 abcd</td> <td>3,80 abcd</td> <td>—</td> <td>—</td> <td>—</td> </tr> <tr> <td>0,88</td> <td>—</td> <td>4,80 —</td> <td>4,80 —</td> <td>4,80 ac</td> <td>4,80 abc</td> <td>4,80 abc</td> <td>—</td> <td>—</td> <td>—</td> </tr> <tr> <td>1,00</td> <td>—</td> <td>5,10 —</td> <td>5,10 —</td> <td>5,70 ac</td> <td>5,70 ac</td> <td>5,70 ac</td> <td>—</td> <td>—</td> <td>—</td> </tr> <tr> <td>1,13</td> <td>—</td> <td>5,50 —</td> <td>5,50 —</td> <td>6,80 ac</td> <td>6,80 a</td> <td>—</td> <td>—</td> <td>—</td> <td>—</td> </tr> <tr> <td>1,25</td> <td>—</td> <td>6,10 —</td> <td>6,10 —</td> <td>7,90 ac</td> <td>7,90 a</td> <td>—</td> <td>—</td> <td>—</td> <td>—</td> </tr> <tr> <td>1,50</td> <td>—</td> <td>6,40 —</td> <td>6,40 —</td> <td>9,00 —</td> <td>10,00 a</td> <td>—</td> <td>—</td> <td>—</td> <td>—</td> </tr> <tr> <td>1,75</td> <td>—</td> <td>6,40 —</td> <td>6,40 —</td> <td>9,00 —</td> <td>10,00 —</td> <td>—</td> <td>—</td> <td>—</td> <td>—</td> </tr> <tr> <td>2,00</td> <td>—</td> <td>7,80 —</td> <td>7,80 —</td> <td>9,40 —</td> <td>10,00 —</td> <td>—</td> <td>—</td> <td>—</td> <td>—</td> </tr> <tr> <td rowspan="11">$N_{e,k}$ [kN]</td> <td>0,50</td> <td>—</td> <td>1,78 ac</td> <td>1,78 abcd</td> <td>1,78 abcd</td> <td>1,78 abcd</td> <td>1,78 abcd</td> <td>—</td> <td>—</td> <td>—</td> </tr> <tr> <td>0,55</td> <td>—</td> <td>2,25 ac</td> <td>2,25 abcd</td> <td>2,25 abcd</td> <td>2,25 abcd</td> <td>2,25 abcd</td> <td>—</td> <td>—</td> <td>—</td> </tr> <tr> <td>0,63</td> <td>—</td> <td>3,21 ac</td> <td>3,30 ac</td> <td>3,30 abcd</td> <td>3,30 abcd</td> <td>3,30 abcd</td> <td>—</td> <td>—</td> <td>—</td> </tr> <tr> <td>0,75</td> <td>—</td> <td>3,21 ac</td> <td>4,00 ac</td> <td>4,00 abcd</td> <td>4,00 abcd</td> <td>4,00 abcd</td> <td>—</td> <td>—</td> <td>—</td> </tr> <tr> <td>0,88</td> <td>—</td> <td>3,21 —</td> <td>4,62 —</td> <td>4,80 ac</td> <td>4,80 abc</td> <td>4,80 abc</td> <td>—</td> <td>—</td> <td>—</td> </tr> <tr> <td>1,00</td> <td>—</td> <td>3,21 —</td> <td>4,62 —</td> <td>5,60 ac</td> <td>5,60 ac</td> <td>5,60 ac</td> <td>—</td> <td>—</td> <td>—</td> </tr> <tr> <td>1,13</td> <td>—</td> <td>3,21 —</td> <td>4,62 —</td> <td>6,03 ac</td> <td>6,40 a</td> <td>—</td> <td>—</td> <td>—</td> <td>—</td> </tr> <tr> <td>1,25</td> <td>—</td> <td>3,21 —</td> <td>4,62 —</td> <td>6,03 ac</td> <td>7,20 a</td> <td>—</td> <td>—</td> <td>—</td> <td>—</td> </tr> <tr> <td>1,50</td> <td>—</td> <td>3,21 —</td> <td>4,62 —</td> <td>6,03 —</td> <td>7,20 a</td> <td>—</td> <td>—</td> <td>—</td> <td>—</td> </tr> <tr> <td>1,75</td> <td>—</td> <td>3,21 —</td> <td>4,62 —</td> <td>6,03 —</td> <td>7,20 —</td> <td>—</td> <td>—</td> <td>—</td> <td>—</td> </tr> <tr> <td>2,00</td> <td>—</td> <td>3,21 —</td> <td>4,62 —</td> <td>6,03 —</td> <td>7,20 —</td> <td>—</td> <td>—</td> <td>—</td> <td>—</td> </tr> <tr> <td>$M_{t,perm}$ [Nm]</td> <td colspan="5">$\Sigma t_i \leq 3,00$ mm: 7 Nm</td> <td colspan="5">$\Sigma t_i > 3,00$ mm: 8 Nm</td> </tr> </tbody> </table>											t_i [mm]	t_i [mm]									1,50	2,00	2,50	3,00	4,00	5,00	6,00	—	—	$N_{t,k}$ [kN]	0,50	—	—	—	—	—	—	—	—	—	0,55	—	—	—	—	—	—	—	—	—	0,63	—	3,00 ac	3,00 ac	3,00 abcd	3,00 abcd	3,00 abcd	—	—	—	0,75	—	3,80 ac	3,80 ac	3,80 abcd	3,80 abcd	3,80 abcd	—	—	—	0,88	—	4,80 —	4,80 —	4,80 ac	4,80 abc	4,80 abc	—	—	—	1,00	—	5,10 —	5,10 —	5,70 ac	5,70 ac	5,70 ac	—	—	—	1,13	—	5,50 —	5,50 —	6,80 ac	6,80 a	—	—	—	—	1,25	—	6,10 —	6,10 —	7,90 ac	7,90 a	—	—	—	—	1,50	—	6,40 —	6,40 —	9,00 —	10,00 a	—	—	—	—	1,75	—	6,40 —	6,40 —	9,00 —	10,00 —	—	—	—	—	2,00	—	7,80 —	7,80 —	9,40 —	10,00 —	—	—	—	—	$N_{e,k}$ [kN]	0,50	—	1,78 ac	1,78 abcd	1,78 abcd	1,78 abcd	1,78 abcd	—	—	—	0,55	—	2,25 ac	2,25 abcd	2,25 abcd	2,25 abcd	2,25 abcd	—	—	—	0,63	—	3,21 ac	3,30 ac	3,30 abcd	3,30 abcd	3,30 abcd	—	—	—	0,75	—	3,21 ac	4,00 ac	4,00 abcd	4,00 abcd	4,00 abcd	—	—	—	0,88	—	3,21 —	4,62 —	4,80 ac	4,80 abc	4,80 abc	—	—	—	1,00	—	3,21 —	4,62 —	5,60 ac	5,60 ac	5,60 ac	—	—	—	1,13	—	3,21 —	4,62 —	6,03 ac	6,40 a	—	—	—	—	1,25	—	3,21 —	4,62 —	6,03 ac	7,20 a	—	—	—	—	1,50	—	3,21 —	4,62 —	6,03 —	7,20 a	—	—	—	—	1,75	—	3,21 —	4,62 —	6,03 —	7,20 —	—	—	—	—	2,00	—	3,21 —	4,62 —	6,03 —	7,20 —	—	—	—	—	$M_{t,perm}$ [Nm]	$\Sigma t_i \leq 3,00$ mm: 7 Nm					$\Sigma t_i > 3,00$ mm: 8 Nm				
t_i [mm]	t_i [mm]																																																																																																																																																																																																																																																																					
	1,50	2,00	2,50	3,00	4,00	5,00	6,00	—	—																																																																																																																																																																																																																																																													
$N_{t,k}$ [kN]	0,50	—	—	—	—	—	—	—	—	—																																																																																																																																																																																																																																																												
	0,55	—	—	—	—	—	—	—	—	—																																																																																																																																																																																																																																																												
	0,63	—	3,00 ac	3,00 ac	3,00 abcd	3,00 abcd	3,00 abcd	—	—	—																																																																																																																																																																																																																																																												
	0,75	—	3,80 ac	3,80 ac	3,80 abcd	3,80 abcd	3,80 abcd	—	—	—																																																																																																																																																																																																																																																												
	0,88	—	4,80 —	4,80 —	4,80 ac	4,80 abc	4,80 abc	—	—	—																																																																																																																																																																																																																																																												
	1,00	—	5,10 —	5,10 —	5,70 ac	5,70 ac	5,70 ac	—	—	—																																																																																																																																																																																																																																																												
	1,13	—	5,50 —	5,50 —	6,80 ac	6,80 a	—	—	—	—																																																																																																																																																																																																																																																												
	1,25	—	6,10 —	6,10 —	7,90 ac	7,90 a	—	—	—	—																																																																																																																																																																																																																																																												
	1,50	—	6,40 —	6,40 —	9,00 —	10,00 a	—	—	—	—																																																																																																																																																																																																																																																												
	1,75	—	6,40 —	6,40 —	9,00 —	10,00 —	—	—	—	—																																																																																																																																																																																																																																																												
	2,00	—	7,80 —	7,80 —	9,40 —	10,00 —	—	—	—	—																																																																																																																																																																																																																																																												
$N_{e,k}$ [kN]	0,50	—	1,78 ac	1,78 abcd	1,78 abcd	1,78 abcd	1,78 abcd	—	—	—																																																																																																																																																																																																																																																												
	0,55	—	2,25 ac	2,25 abcd	2,25 abcd	2,25 abcd	2,25 abcd	—	—	—																																																																																																																																																																																																																																																												
	0,63	—	3,21 ac	3,30 ac	3,30 abcd	3,30 abcd	3,30 abcd	—	—	—																																																																																																																																																																																																																																																												
	0,75	—	3,21 ac	4,00 ac	4,00 abcd	4,00 abcd	4,00 abcd	—	—	—																																																																																																																																																																																																																																																												
	0,88	—	3,21 —	4,62 —	4,80 ac	4,80 abc	4,80 abc	—	—	—																																																																																																																																																																																																																																																												
	1,00	—	3,21 —	4,62 —	5,60 ac	5,60 ac	5,60 ac	—	—	—																																																																																																																																																																																																																																																												
	1,13	—	3,21 —	4,62 —	6,03 ac	6,40 a	—	—	—	—																																																																																																																																																																																																																																																												
	1,25	—	3,21 —	4,62 —	6,03 ac	7,20 a	—	—	—	—																																																																																																																																																																																																																																																												
	1,50	—	3,21 —	4,62 —	6,03 —	7,20 a	—	—	—	—																																																																																																																																																																																																																																																												
	1,75	—	3,21 —	4,62 —	6,03 —	7,20 —	—	—	—	—																																																																																																																																																																																																																																																												
	2,00	—	3,21 —	4,62 —	6,03 —	7,20 —	—	—	—	—																																																																																																																																																																																																																																																												
$M_{t,perm}$ [Nm]	$\Sigma t_i \leq 3,00$ mm: 7 Nm					$\Sigma t_i > 3,00$ mm: 8 Nm																																																																																																																																																																																																																																																																
No additional regulations.																																																																																																																																																																																																																																																																						
Self drilling screw										Annex 26																																																																																																																																																																																																																																																												
Hilti S-MD 53 Z 6,3 x L Hilti S-MD 53 C 6,3 x L with hexagon head and sealing washer $\geq \varnothing 16$ mm																																																																																																																																																																																																																																																																						

Annex 18:
ETA-10/0182, Annex 27

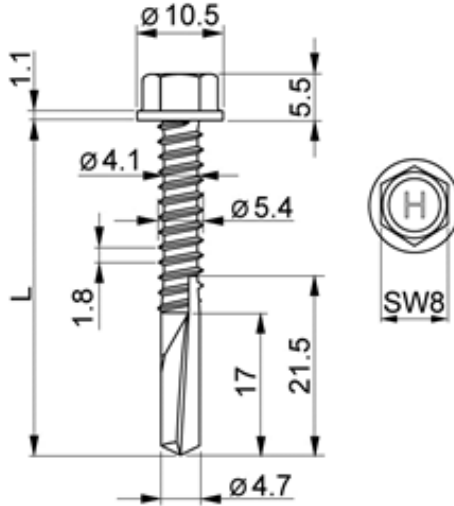

Material:
Fastener: carbon steel, case hardened and galvanized or coated
Washer: none
Component I: S280GD, S320GD - EN 10346
Component II: S280GD, S320GD - EN 10346
S235 - EN 10025-1

Drilling capacity: $\Sigma t_i \leq 15,00$ mm

Timber substructures:
no performance determined

t [mm]	t _i [mm]								
	2,00	3,00	4,00	6,00	8,00	10,0	12,0	≥ 14,0	
V _{0,5} [kN]	0,50	—	—	—	—	—	—	—	—
	0,55	—	—	—	—	—	—	—	—
	0,63	—	—	2,49	2,49	2,49	2,49	2,49	2,49
	0,75	—	—	3,04	3,04	3,04	3,04	3,04	3,04
	0,88	—	—	3,87	3,87	3,87	3,87	3,87	3,87
	1,00	—	—	4,91	4,91	4,91	4,91	4,91	4,91
	1,13	—	—	6,24	6,24	6,24	6,24	6,24	—
	1,25	—	—	7,69	7,69	7,69	7,69	7,69	—
	1,50	—	—	7,69	7,69	7,69	7,69	7,69	—
	1,75	—	—	7,69	7,69	7,69	7,69	7,69	—
	2,00	—	—	7,69	7,69	7,69	7,69	7,69	—
N _{0,5} [kN]	0,50	—	—	—	—	—	—	—	—
	0,55	—	—	—	—	—	—	—	—
	0,63	—	—	2,50	2,50	2,50	2,50	2,50	2,50
	0,75	—	—	2,99	2,99	2,99	2,99	2,99	2,99
	0,88	—	—	3,50	3,50	3,50	3,50	3,50	3,50
	1,00	—	—	3,99	3,99	3,99	3,99	3,99	3,99
	1,13	—	—	4,50	4,50	4,50	4,50	4,50	—
	1,25	—	—	4,97	4,97	4,97	4,97	4,97	—
	1,50	—	—	5,99	5,99	5,99	5,99	5,99	—
	1,75	—	—	6,95	6,95	6,95	6,95	6,95	—
	2,00	—	—	7,96	7,96	7,96	7,96	7,96	—
M _{0,5} [Nm]	5 Nm								

No additional regulations.

Self drilling screw

Hilti S-MD 05 GZ 5,5 x L
Hilti S-MD 05 GC 5,5 x L
Hilti S-MD 05 Z 5,5 x L
Hilti S-MD 05 C 5,5 x L
with hexagon head

Annex 27

Annex 19:
ETA-10/0182, Annex 28

	<p>Material:</p> <p>Fastener: carbon steel, case hardened and galvanized or coated</p> <p>Washer: none</p> <p>Component I: S280GD, S320GD - EN 10346</p> <p>Component II: S280GD, S320GD - EN 10346 S235 - EN 10025-1</p>																																																																																																																																																																																																																																																																			
	<p>Drilling capacity: $\Sigma t_i \leq 15,00$ mm</p> <p>Timber substructures: no performance determined</p>																																																																																																																																																																																																																																																																			
<table border="1"> <thead> <tr> <th rowspan="2">t_i [mm]</th> <th colspan="9">t_i [mm]</th> </tr> <tr> <th>2,00</th> <th>3,00</th> <th>4,00</th> <th>6,00</th> <th>8,00</th> <th>10,0</th> <th>12,0</th> <th colspan="2">$\geq 14,0$</th> </tr> </thead> <tbody> <tr> <td rowspan="11">$N_{t,k}$ [kN]</td> <td>0,50</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td>0,55</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td>0,63</td><td>—</td><td>—</td><td>2,49</td><td>2,49</td><td>2,49</td><td>2,49</td><td>2,49</td><td>2,49</td><td>2,49</td> </tr> <tr> <td>0,75</td><td>—</td><td>—</td><td>3,04</td><td>3,04</td><td>3,04</td><td>3,04</td><td>3,04</td><td>3,04</td><td>3,04</td> </tr> <tr> <td>0,88</td><td>—</td><td>—</td><td>3,87</td><td>3,87</td><td>3,87</td><td>3,87</td><td>3,87</td><td>3,87</td><td>3,87</td> </tr> <tr> <td>1,00</td><td>—</td><td>—</td><td>4,91</td><td>4,91</td><td>4,91</td><td>4,91</td><td>4,91</td><td>4,91</td><td>4,91</td> </tr> <tr> <td>1,13</td><td>—</td><td>—</td><td>6,24</td><td>6,24</td><td>6,24</td><td>6,24</td><td>6,24</td><td>6,24</td><td>—</td> </tr> <tr> <td>1,25</td><td>—</td><td>—</td><td>7,69</td><td>7,69</td><td>7,69</td><td>7,69</td><td>7,69</td><td>7,69</td><td>—</td> </tr> <tr> <td>1,50</td><td>—</td><td>—</td><td>7,69</td><td>7,69</td><td>7,69</td><td>7,69</td><td>7,69</td><td>7,69</td><td>—</td> </tr> <tr> <td>1,75</td><td>—</td><td>—</td><td>7,69</td><td>7,69</td><td>7,69</td><td>7,69</td><td>7,69</td><td>7,69</td><td>—</td> </tr> <tr> <td>2,00</td><td>—</td><td>—</td><td>7,69</td><td>7,69</td><td>7,69</td><td>7,69</td><td>7,69</td><td>7,69</td><td>—</td> </tr> <tr> <td rowspan="11">$N_{t,x}$ [kN]</td> <td>0,50</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td>0,55</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td><td>—</td> </tr> <tr> <td>0,63</td><td>—</td><td>—</td><td>2,50</td><td>2,50</td><td>2,50</td><td>2,50</td><td>2,50</td><td>2,50</td><td>2,50</td> </tr> <tr> <td>0,75</td><td>—</td><td>—</td><td>2,99</td><td>2,99</td><td>2,99</td><td>2,99</td><td>2,99</td><td>2,99</td><td>2,99</td> </tr> <tr> <td>0,88</td><td>—</td><td>—</td><td>3,50</td><td>3,50</td><td>3,50</td><td>3,50</td><td>3,50</td><td>3,50</td><td>3,50</td> </tr> <tr> <td>1,00</td><td>—</td><td>—</td><td>3,99</td><td>3,99</td><td>3,99</td><td>3,99</td><td>3,99</td><td>3,99</td><td>3,99</td> </tr> <tr> <td>1,13</td><td>—</td><td>—</td><td>4,50</td><td>4,50</td><td>4,50</td><td>4,50</td><td>4,50</td><td>4,50</td><td>—</td> </tr> <tr> <td>1,25</td><td>—</td><td>—</td><td>4,97</td><td>4,97</td><td>4,97</td><td>4,97</td><td>4,97</td><td>4,97</td><td>—</td> </tr> <tr> <td>1,50</td><td>—</td><td>—</td><td>5,99</td><td>5,99</td><td>5,99</td><td>5,99</td><td>5,99</td><td>5,99</td><td>—</td> </tr> <tr> <td>1,75</td><td>—</td><td>—</td><td>6,95</td><td>6,95</td><td>6,95</td><td>6,95</td><td>6,95</td><td>6,95</td><td>—</td> </tr> <tr> <td>2,00</td><td>—</td><td>—</td><td>7,96</td><td>7,96</td><td>7,96</td><td>7,96</td><td>7,96</td><td>7,96</td><td>—</td> </tr> <tr> <td>$M_{t,adm}$ [Nm]</td> <td colspan="9">5 Nm</td> </tr> </tbody> </table>										t_i [mm]	t_i [mm]									2,00	3,00	4,00	6,00	8,00	10,0	12,0	$\geq 14,0$		$N_{t,k}$ [kN]	0,50	—	—	—	—	—	—	—	—	—	0,55	—	—	—	—	—	—	—	—	—	0,63	—	—	2,49	2,49	2,49	2,49	2,49	2,49	2,49	0,75	—	—	3,04	3,04	3,04	3,04	3,04	3,04	3,04	0,88	—	—	3,87	3,87	3,87	3,87	3,87	3,87	3,87	1,00	—	—	4,91	4,91	4,91	4,91	4,91	4,91	4,91	1,13	—	—	6,24	6,24	6,24	6,24	6,24	6,24	—	1,25	—	—	7,69	7,69	7,69	7,69	7,69	7,69	—	1,50	—	—	7,69	7,69	7,69	7,69	7,69	7,69	—	1,75	—	—	7,69	7,69	7,69	7,69	7,69	7,69	—	2,00	—	—	7,69	7,69	7,69	7,69	7,69	7,69	—	$N_{t,x}$ [kN]	0,50	—	—	—	—	—	—	—	—	—	0,55	—	—	—	—	—	—	—	—	—	0,63	—	—	2,50	2,50	2,50	2,50	2,50	2,50	2,50	0,75	—	—	2,99	2,99	2,99	2,99	2,99	2,99	2,99	0,88	—	—	3,50	3,50	3,50	3,50	3,50	3,50	3,50	1,00	—	—	3,99	3,99	3,99	3,99	3,99	3,99	3,99	1,13	—	—	4,50	4,50	4,50	4,50	4,50	4,50	—	1,25	—	—	4,97	4,97	4,97	4,97	4,97	4,97	—	1,50	—	—	5,99	5,99	5,99	5,99	5,99	5,99	—	1,75	—	—	6,95	6,95	6,95	6,95	6,95	6,95	—	2,00	—	—	7,96	7,96	7,96	7,96	7,96	7,96	—	$M_{t,adm}$ [Nm]	5 Nm								
t_i [mm]	t_i [mm]																																																																																																																																																																																																																																																																			
	2,00	3,00	4,00	6,00	8,00	10,0	12,0	$\geq 14,0$																																																																																																																																																																																																																																																												
$N_{t,k}$ [kN]	0,50	—	—	—	—	—	—	—	—	—																																																																																																																																																																																																																																																										
	0,55	—	—	—	—	—	—	—	—	—																																																																																																																																																																																																																																																										
	0,63	—	—	2,49	2,49	2,49	2,49	2,49	2,49	2,49																																																																																																																																																																																																																																																										
	0,75	—	—	3,04	3,04	3,04	3,04	3,04	3,04	3,04																																																																																																																																																																																																																																																										
	0,88	—	—	3,87	3,87	3,87	3,87	3,87	3,87	3,87																																																																																																																																																																																																																																																										
	1,00	—	—	4,91	4,91	4,91	4,91	4,91	4,91	4,91																																																																																																																																																																																																																																																										
	1,13	—	—	6,24	6,24	6,24	6,24	6,24	6,24	—																																																																																																																																																																																																																																																										
	1,25	—	—	7,69	7,69	7,69	7,69	7,69	7,69	—																																																																																																																																																																																																																																																										
	1,50	—	—	7,69	7,69	7,69	7,69	7,69	7,69	—																																																																																																																																																																																																																																																										
	1,75	—	—	7,69	7,69	7,69	7,69	7,69	7,69	—																																																																																																																																																																																																																																																										
	2,00	—	—	7,69	7,69	7,69	7,69	7,69	7,69	—																																																																																																																																																																																																																																																										
$N_{t,x}$ [kN]	0,50	—	—	—	—	—	—	—	—	—																																																																																																																																																																																																																																																										
	0,55	—	—	—	—	—	—	—	—	—																																																																																																																																																																																																																																																										
	0,63	—	—	2,50	2,50	2,50	2,50	2,50	2,50	2,50																																																																																																																																																																																																																																																										
	0,75	—	—	2,99	2,99	2,99	2,99	2,99	2,99	2,99																																																																																																																																																																																																																																																										
	0,88	—	—	3,50	3,50	3,50	3,50	3,50	3,50	3,50																																																																																																																																																																																																																																																										
	1,00	—	—	3,99	3,99	3,99	3,99	3,99	3,99	3,99																																																																																																																																																																																																																																																										
	1,13	—	—	4,50	4,50	4,50	4,50	4,50	4,50	—																																																																																																																																																																																																																																																										
	1,25	—	—	4,97	4,97	4,97	4,97	4,97	4,97	—																																																																																																																																																																																																																																																										
	1,50	—	—	5,99	5,99	5,99	5,99	5,99	5,99	—																																																																																																																																																																																																																																																										
	1,75	—	—	6,95	6,95	6,95	6,95	6,95	6,95	—																																																																																																																																																																																																																																																										
	2,00	—	—	7,96	7,96	7,96	7,96	7,96	7,96	—																																																																																																																																																																																																																																																										
$M_{t,adm}$ [Nm]	5 Nm																																																																																																																																																																																																																																																																			
No additional regulations.																																																																																																																																																																																																																																																																				
Self drilling screw																																																																																																																																																																																																																																																																				
Hilti S-MD 25 Z 5,5 x L Hilti S-MD 25 C 5,5 x L with hexagon head with collar								Annex 28																																																																																																																																																																																																																																																												

Annex 20:
ETA-10/0182, Annex 29

Material:

Fastener: carbon steel, case hardened and galvanized or coated

Washer: carbon steel, galvanized or coated stainless Steel (1.4301) - EN 10088

Component I: S280GD, S320GD - EN 10346

Component II: S280GD, S320GD - EN 10346
S235 - EN 10025-1

Drilling capacity: $\Sigma t_i \leq 15,00$ mm

Timber substructures:
no performance determined

	t [mm]	t _i [mm]								
		2,00	3,00	4,00	6,00	8,00	10,0	12,0	≥ 14,0	
V _{0,5} [kN]	0,50	—	—	—	—	—	—	—	—	—
	0,55	—	—	—	—	—	—	—	—	—
	0,63	—	—	2,49	2,49	2,49	2,49	2,49	2,49	—
	0,75	—	—	3,04	3,04	3,04	3,04	3,04	3,04	—
	0,88	—	—	3,87	3,87	3,87	3,87	3,87	3,87	—
	1,00	—	—	4,91	4,91	4,91	4,91	4,91	4,91	—
	1,13	—	—	6,24	6,24	6,24	6,24	6,24	6,24	—
	1,25	—	—	7,69	7,69	7,69	7,69	7,69	7,69	—
	1,50	—	—	7,69	7,69	7,69	7,69	7,69	7,69	—
	1,75	—	—	7,69	7,69	7,69	7,69	7,69	7,69	—
2,00	—	—	7,69	7,69	7,69	7,69	7,69	7,69	—	
N _{0,5} [kN]	0,50	—	—	—	—	—	—	—	—	—
	0,55	—	—	2,32	2,32	2,32	2,32	2,32	2,32	—
	0,63	—	—	2,55	2,55	2,55	2,55	2,55	2,55	—
	0,75	—	—	3,02	3,02	3,02	3,02	3,02	3,02	—
	0,88	—	—	3,51	3,51	3,51	3,51	3,51	3,51	—
	1,00	—	—	4,00	4,00	4,00	4,00	4,00	4,00	—
	1,13	—	—	4,51	4,51	4,51	4,51	4,51	4,51	—
	1,25	—	—	4,99	4,99	4,99	4,99	4,99	4,99	—
	1,50	—	—	6,06	6,06	6,06	6,06	6,06	6,06	—
	1,75	—	—	7,09	7,09	7,09	7,09	7,09	7,09	—
2,00	—	—	8,23	8,23	8,23	8,23	8,23	8,23	—	
M _{0,05m} [Nm]	5 Nm									

No additional regulations.

Self drilling screw

Hilti S-MD 55 GZ 5,5 x L
Hilti S-MD 55 GC 5,5 x L
Hilti S-MD 55 Z 5,5 x L
Hilti S-MD 55 C 5,5 x L
with hexagon head and sealing washer ≥ Ø16 mm

Annex 29